a written corrective action plan describing the specific actions which it plans to take. Section 1115.20(a) of the regulations on Substantial Product Hazard Reports, 16 C.F.R. § 1115.20(a), outlines the elements of an appropriate corrective action plan. The staff has also enclosed examples of recall actions taken by firms that the firm may find useful. The staff will review the firm's plan promptly and discuss with it any suggestions it has or additional measures it believes Hydro Air Industries, Inc. should take.

Additionally, rather than the Commission unilaterally issuing a press release, the staff believes it would be appropriate for the firm and the Commission to issue a joint press release announcing the corrective action plan. The staff will work with the firm to develop and issue a mutually acceptable release.

A voluntary corrective action plan must include an agreement that the Commission may publicize the terms of the plan and inform the public of the nature and the extent of the alleged substantial product hazard. Please read carefully the enclosed document on "Information Disclosure" dated May 12, 1983. This document discusses the statutes and regulations which govern the Commission's disclosure of information and explains Commission staff's policy on the disclosure of information concerning product recalls and similar actions.

When the corrective action program begins, the Division of Corrective Actions will monitor the progress of the corrective action. The staff requests that the firm provide monthly progress reports to the Division of Corrective Actions (using the enclosed form). Please provide customer lists and any other information requested so that the staff can monitor the effectiveness of the corrective action at various levels of the distribution chain.

#### Information Requested

Please submit the following information and samples:

1. Copies of all test reports, analysis, and evaluations including premarket tests and reports of tests and any analyses related to the reported problem involving the model 10-6200 suction cover, including the date and place such tests and analyses were conducted by or on behalf of the firm and the identity of the persons involved in the testing and analyses.

85

- 2. Copies of all performance tests concerning the firm's retrofit for the model 10-6200 suction fitting cover.
- 3. The types of installations that would use the 10-6200 model suction fitting cover.
- 4. The most common position of the 10-6200 suction cover when installed.
- 5. The flow rate for the 10-6200 suction cover.
- 6. Two retrofit suction cover samples including instructions to be provided for consumer use.
- 7. A list of distributors that received the model 10-6200 suction fitting cover.

#### Compliance With Reporting Obligations

Once agreement is reached on a corrective action plan and the plan is implemented, if appropriate, the staff will also investigate and assess whether it believes the firm has complied with the reporting requirements of Section 15(b) of the CPSA, 15 U.S.C. § 2064(b). That section requires every manufacturer, distributor, and retailer of a consumer product who obtains information which reasonably supports the conclusion that the product (1) contains a defect which could create a substantial product hazard, or (2) creates an unreasonable risk of serious injury or death, immediately to inform the Commission of the defect, or risk, unless the firm has actual knowledge that the Commission has been adequately informed of the defect, or the See 16 C.F.R. Part 1115. The CPSA makes it a prohibited act to violate the reporting requirement. Firms may be liable for a civil penalty of \$5000 for each product involved up to a maximum of \$1,250,000 for any related series of violations. Sections 15(b), 19(a)(4), 20 and 21 of the CPSA, as amended, 15 U.S.C. §§ 2064(b), 2068(a)(4), 2069 and 2070, describes the obligation of manufacturers, distributors and retailers to furnish information to the Commission and the penalties for failing to furnish such information.

If the firm receives any information concerning other incidents or injuries, or information affecting the scope, prevalence or seriousness of the defect or hazard, it must report that information to this Division immediately. Additionally, if the firm receives information which might indicate that its corrective actions are not satisfactory in eliminating the defect

Sto

Page 4

or hazard or that the effectiveness of the corrective action program is less than what has been reported, it must report that information to this Division immediately.

The staff requests a response within 10 working days from receipt of this letter. Please reference the CPSC file number in your response.

The staff will make every effort to work closely and cooperatively with the firm to assure a successful corrective action plan which will protect the public while at the same time create a minimum of burden and inconvenience for the firm. If you have any questions or desire assistance in responding to this letter, you may contact Judith Hayes, U.S. Consumer Product Safety Commission, 4330 East West Highway, Room 613, Washington, D.C. 20207-0001, telephone: (301) 504-0608, extension 1355.

Sincerely,

Marc J. Schoem
Director
Division of Corrective Actions

#### Enclosures

Progress Report Form Information Disclosure Sheet Examples of Notification Measures

Cc: Consumer Product Safety Commission
Western Regional Center
600 Harrison Street
Room 245
San Francisco, CA 94107-1370



#### SUCTION FITTING INSTALLATION INSTRUCTIONS

Making sure the surface is flat for best possible seal, drill a hole to suit the wall fitting being installed.

#### RECOMMENDED HOLE SAW SIZES ARE:

#10-6906 & 10-6906M #10-6806 & 10-6806M


SLIMLINE SUCTION HI VOLUME SUCTION

#10-6001

MAIN DRAIN

#### NOTE: SEE REVERSE SIDE FOR PROPER SUCTION FITTING ASSEMBLIES.

- 2. The gasket, when used, should be placed on the outside surface of the spa/tub. On a radius, the gasket should be placed on the inside of spaltub to obtain the best seal. Make sure the sealing surface is smooth to provide for a good seal.
- 3. Before inserting the wall fitting through the hole, apply silicone to the threads. This will help seal the wall fitting and the nut.
- 4. Using a wrench, hand tighten the wall fitting into the nut, it is not necessary to overtighten as the gasket and silicone will create a good seal.
- 5. Screw the suction cover with threaded adapter into wall fitting until adapter bottoms out. On the Slimline model, #10-6906 & 10-6906M, the cover will lock automatically when fully tightened. All other models require the locking screw to be placed through the face of the cover in the provided hole, and tightened until the cover is secure... and the state of the state of the same
- 6. To remove the cover, on Slimline models, lift the latch at the side of the cover while rotating counter clockwise. Other models require the removal of the locking screw and then rotating the cover counter clockwise.

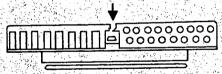

NOTE: To reduce the risk of drowning from hair and body entrapment, install a suction fitting(s) with a marked flow rate in gallons per minute that equals or exceeds the flow rate of your system. Use multiple suction outlets. If fitting breaks, replace it.

#### NOTICE TO BATHER

- 1. Keep hair and clothing a minimum of twelve inches away from the suction fitting at all times. Persons with long hair should either secure hair to a minimum length or wear a bathing cap.
- 2. Children should NEVER use or be left unattended at any time in a swimming pool, spa, hot tub, whirlpool or jetted bathtub.

AS WITH ANY BODY OF WATER, A BATHER SHOULD NEVER USE IT ALONE OR WITHOUT SUPERVISION.

# HYDRO AIR INDUSTRIES INC.

1317W.GROVEAVE, ORANGE, CA.92665 - 714/974-1920

DATE: June 23, 1994
TO COMPANY: <u>OPSC</u>
ATTENTION: Judith Hays
FROM: Sheri Martine
NUMBER OF PAGES (INCLUDING THIS COVER SHEET):
MESSAGE: Article you requested. Hope it is readable.

FAX [714] 974-5371

## Girl's life saved, but not her hair

By THE GRANT The Park Street, London, Londo

LECANTO - Aisling Godwin had always en proud of her hair, which had been cut only ence in her 9 years.

But when her waist-length blood locks got trapped in the drain of a friend's hot tub April 8, a quick haircut was the only thing that saved her life.

For about seven minutes, the elementary pol pupil was trapped beneath the warm, bubbling spe waters.

"I was trying to get out, I thought I was going to dia," Aiding said. "I remember someone pulling my legs and I couldn't hold my breath anymore so I just went to sleep."

The textilying ordeal began innocently crough.

Aisling of Onello in Citrus County was spending the night with her best friend, Tiffany Griffith, 10, in Timberlane Estates.

Kathy Griffith said her two children and Airling had been playing in the awimming pool that morning, then secided to join ber in the hot tub. The water level was low, so Mrs. Griffith, 38, left to call her husband at work for directions on how to raise the level.

The girls decided to go in the hot tub, and while playing a game called "truth or dare," Aisling tried to do a headstand. The tub's strong water pump sucked in her long hair, tanging it around the drain's plantic cover.

Tiffany ran isto the house, saying that Assing was trapped. Mrs. Griffith said she dropped the phone and turned off the hot tub's circuit breaker. But the children still were not able to free Aisling.

Just then, Tom Scheefer, a 43-year-old mechanic with Consumer Car Care in Beverby Hills, arrived at the house to deliver a repaired car. Mrs. Griffith shouted for him to go to the spe and help the children while she ran upstairs, found a pair of scienors and disled 911.

Schaeler jumped into the water and after being handed the acissors, extricated Aisling with a few quick snips, "Believe me, I was not trying to be a beauticism."

"When they pulled her out of the water she wann't breathing." Mrs. Griffish said. "The repulymen gave her mouth to mouth and when she came back, she was discrimi-ed. She thought she was still underwater and she was fighting and struggling, trying to get

"She was acreaming, "Cut my hair. Cut my hair. Phone cut my hair." And I tried to calm her by telling her it's already been done, and she was not it danger."

Aisling's mother, Debra, 38, was called while paramedica treated the girl. She fol-lowed her daughter to Seven Rivers Commu-nity Homeltal, where Aisling was been over-

nity Hospital, where Aisling was kept overmight for observation.

"It's a very scary feeling to have nonconce tell you something like that has happened to your child," also said, "but the first thing Kathy teld me when she called was that Alaline was obey.

Although the incident seems biserre, records show it is not that uncorner.

A November 1901 study by the American Academy of Family Physicians found 151 cases of people dying in hot tube. The deaths were reported by modical examiners, coto-more and the U.S. Consumer Product Safety



ligiing Godwin nearly drowned April & when her long helr become tangled in a hot-lub drain at a friend's house. Now the youngater says she doesn't went to go neer a spa.

Forty percent of the spa-related deaths involved children younger than 12 The children often fell into nacovered apan or became trapped by the mmur's suction, the study

The Griffiths' spa was mutalled by Aprillo bals and Spas. The company's co-owner. Chris Brantley, said that the equipment has passed stringent testing and that some are intended as relatation sports, not as play areas for children.

"You sit in a spa. You don't play in it. You lou't dive in it," he saul. "A spa is not a place for small children. A swimming pand would be

Mrx. Godwin said she did not want Aislit to lear going back to Tiffany's house, nor d she want her daughter to fear going back in the water, so both parents encouraged the children to go swimming at Tiffany's hou the same day Aisling was released from the heapital.

The children enjoyed going swimmin but none of them wanted to go near the h tub. Even when posing for a Times photogr pher, Anding refused to dip her toe into the whirlprol that almost took her life.

"I never want to go into another spa,"





1317W.GROVEAVE,,ORANGE,CA.92665 **1** 714/974-1920

June 15, 1994

U.S. Consumer Products Safety Commission Compliance 4330 East West Hwy Room 613 Bethesda, Md. 20814-4408

Attn: Judith Hayes

Re: Your letter dated April 22, 1994

CPSC RP940116

Model 10-6200 Suction Fitting

RECEIVED

JUN 2 2 P.M.

Compliance and Enforcement

Dear Ms. Hayes,

We are currently working on the suction fitting in question. This letter will contain the details and descriptions of the fitting in question. Samples will be sent along with this letter, as requested. This letter will not contain corrective action plans.

- 1. Person submitting report:
  David Allen
  Vice President Manufacturing
  Hydro Air Industries, Inc
  1317 W. Grove Ave
  Orange, Ca. 92665
- 2. Manufacturer of fitting: Hydro Air Industries, Inc 1317 W. Grove Ave Orange, Ca. 92665
- Description of fitting:
   Main Drain; Part Number 10-6200
   line drawing included as enclosure #1
- 4. Listing certificate enclosed as item #2.
  Part number 10-6200 is listed in accordance with ANSI/ ASME A112-19.8
- Nature of the injury:
   No injury accident was a near drowning
- 6. Received word of the accident via phone mid April, 1994.
- 7. 1 main drain was involved.

8. This item has been in production since 1980. Total units sold for years 1980 through May, 1994 is 205,126.


Ms. Hayes, we are working on a retrofit cover for this product. We expect this will take a few months at best. If you require additional information on the items discussed above, or other items of interest to you, please contact me at your convenience.

Sincerely,

David allen

David Allen V.P. Manufacturing

ENCLOSURE #1

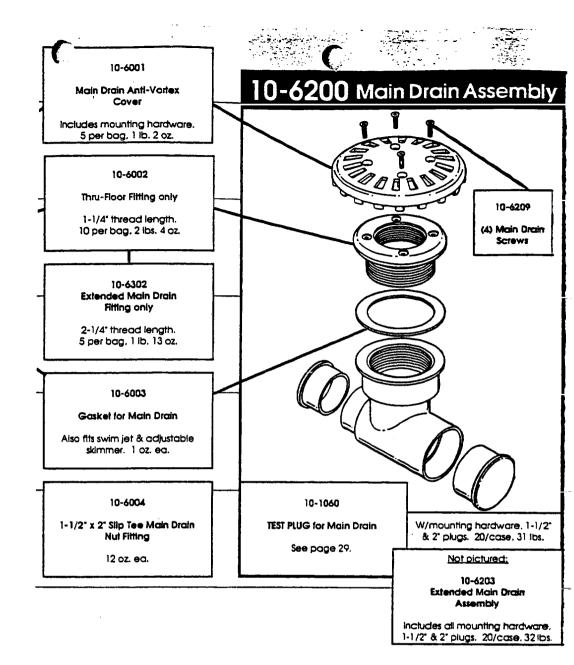

,,,,

#### INTERNATIONAL ASSOCIATION OF PLUMBING AND MECHANICAL **OFFICIALS**



A NONPROFIT CORPORATION

#### CERTIFICATE OF LISTING



Samples of the product described herein have been tested by an independent testing laboratory and have been reviewed and accepted for listing by the Plumbing Research Committee of the International Association of Plumbing and Mechanical Officials as meeting the requirements of the Uniform Swimming Pool, Spa and Hot Tub Code™. This listing is subject to the conditions set forth in the characteristics below and is not to be construed as any recommendation, assurance or quarantee by the Association of the product or of product acceptance by local jurisdictions or authorities using the Uniform Swimming Pool, Spa and Hot Tub Code™ or otherwise affiliated with the Association.

Accepted March 1994

Void After March 1995

PRODUCT:

Suction Fittings

FILE NO. SP-1122

APPLICANT:

Hydro Air Industries, Inc.

1317 W. Grove Avenue Orange, CA 92665

IDENTIFICATION:

USPC® certification mark shall be on outside visible surface of cover. Manufacturers name or logo, GPM, and

model designation shall be on a visible surface or under

cover or on body of fitting.

CHARACTERISTICS: The assembly is comprised of a safety cover (brass,

stainless steel, or plastic), mounting body and threaded lock (nut or elbow). The cover must require the use of a tool to remove and meet the requirements of ANSI A112.19.8%-1987 for anti-hair and body entrapment per section 308(d) and (e) of the USPC. May or may not be self-draining. For

spas, whirlpool baths and hot tubs.

MODELS:

10-6106 - 36 GPM, 10-6106M - 52 GPM, 10-6200 - 56 GPM, 10-6406 - 65 GPM, 10-6406M - 92 GPM, 10-6806 - 100 GPM, 10-6806-M - 100 GPM, 10-6906 - 68 GPM & 10-6906M - 60 GPM.

This listing is for the period indicated herein and is void after date shown above. Any change in material, manufacturing process, marking or design without having first obtained the approval of the Plumbing Research Committee, or evidence of non-compliance with applicable standards or of inferior workmanship, may be deemed as sufficient cause for revocation of the listing. Reproduction or reference to this form for advertising purposes may be made only by specific written permission of the International Association of Plumbing and Mechanical Officials. This authorizes the use of the USPC® certification mark on products covered by this certificate.

ny alteration withis certificate could be grounds for revocation of the listing.

Kemet S. K

Sponsors of the Uniform Plumbing Code™, Uniform Swimming Pool, Spa and Hot Tub Code™ and Uniform Solar Energy Code™, Co-Sponsors of the Uniform Mechanical Code™.

HYDRO AIR INDUSTRIES, INC. 1317 W. GROVE AVE. ORANGE, JA 92565

PACKING LIS

ខិតចូលន

Grøer Number: 19105

Order Date: 06/15/94 Print Date: 06/15/94

Bill To: MISC

MISCELLANEOUS

Ship To: CFSC1

CPSC.

4330 E. WEST HWY ROOM 613 BETHEBDA,, MD 20814-4408

Salesperson[1]: --- [2]:

Credit Terms:

Ship Via: UPS

FOB Point: ORANGE, CA.

Purchase Order: ATTN: JUDITH HAYS

Remarks: TODAY

Oty Open Lot/Serial En Item Number Rev T Location Ref Oty to Ship UM Shippe 2.0 EA 06/15/9 1 10-6200WHT 1000 MAIN DRAIN ASY WHITE / \_ 1.0 EA 06/15/9 2 99-9999 1000

ENVELOPE

RM 19108 GND SAV 302 4.3



June 15, 1994

U.S. Consumer Products Safety Commission Compliance 4330 East West Hwy Room 613 Bethesda, Md. 20814-4408

Attn: Judith Hayes

Re: Your letter dated April 22, 1994

CPSC RP940116

Model 10-6200 Suction Fitting

Dear Ms. Hayes,

We are currently working on the suction fitting in question. This letter will contain the details and descriptions of the fitting in question. Samples will be sent along with this letter, as requested. This letter will not contain corrective action plans.

- 1. Person submitting report:
  David Allen
  Vice President Manufacturing
  Hydro Air Industries, Inc
  1317 W. Grove Ave
  Orange, Ca. 92665
- Manufacturer of fitting: Hydro Air Industries, Inc 1317 W. Grove Ave Orange, Ca. 92665
- Description of fitting:
   Main Drain; Part Number 10-6200
   line drawing included as enclosure #1
- 4. Listing certificate enclosed as item #2.
  Part number 10-6200 is listed in accordance with ANSI/ ASME A112-19.8
- 5. Nature of the injury:
  No injury accident was a near drowning
- 6. Received word of the accident via phone mid April, 1994.
- 1 main drain was involved.

96

FAX [714] 974-5371

8. This item has been in production since 1980. Total units sold for years 1980 through May, 1994 is 205,126.

Ms. Hayes, we are working on a retrofit cover for this product. We expect this will take a few months at best. If you require additional information on the items discussed above, or other items of interest to you, please contact me at your convenience.

Sincerely,


Donid aum

David Allen V.P. Manufacturing

moduled with secured drowning winds with secured drowning with secured drowning with secured drowning with secured drowning.

JUN-15-1994 13:41

ENCLOSURE

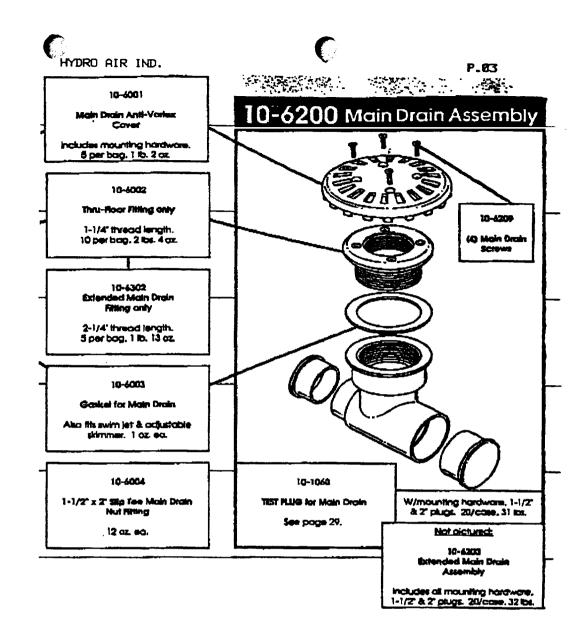

#### INTERNATIONAL ASSOCIATION OF PLUMBING AND MECHANICAL OFFICIALS



A NONPROFIT CORPORATION

#### CERTIFICATE OF LISTING



Samples of the product described herein have been tested by an independent testing laboratory and have been reviewed and accepted for listing by the Plumbing Research Committee of the International Association of Plumbing and Mechanical Officials as meeting the requirements of the Uniform Swimming Pool, Spa and Hot Tub Code™. This listing is subject to the conditions sat forth in the characteristics below and is not to be construed as any recommendation, assurance or guarantee by the Association of the product or of product acceptance by local jurisdictions or authorities using the Uniform Swimming Pool, Spa and Hot Tub Code™ or otherwise affiliated with the Association.

Accepted March 1994

Yold After Warch 1995

PRODUCT:

Suction Fiftings

FILE NO. SP-3122

APPLICANT:

Hydro Air Industries, Inc.

1317 W. Grove Avenue Orange, CA 92665

IDENTIFICATION:

USPC® certification mark shall be an outside visible surface of cover. Manufacturers name or logo, GPM, and model designation shall be on a visible surface or under

cover or on body of fitting.

CHARACTERISTICS: The desembly is comprised of a safety cover (bross, stainless steel, or plastic), mounting body and threaded lock (nut or elbow). The cover must require the use of a tool to remove and meet the requirements of ANSI A112.19.84-1987 for anti-hair and body entrapment per section 308(d) and (e) of the USPC. May or may not be self-draining. For

spas, whiripool boths and hot tubs.

MODELS:

10-6106 - 36 GPM, 10-6106M - 52 GPM, 10-6200 - 56 GPM, 10-6406 - 65 GPM, 10-6406M - 92 GFM, 10-6806 - 100 GPM, 10-6806-M - 100 GFM, 10-6906 - 68 GPM & 10-6906M - 60 GFM.

This listing is for the period indicated herein and is void after date above, any change in material, manufacturing process design without reving first obtained the approval of the Pumbing Research Committee, or evidence of non-compliance with applicator of inferior workmenship, may be deemed as sufficient cause for revocation of the listing. Reproduction or reference to this form if purposes may be made only by specific written permission of the international Association of Pumbing and Machanical Officials. To the use of the USPOS cartification mark on products covered by this certificate.

rificate could be grounds for revocation of the listing

INLIAN, PLUMBING RESEARCH COUNTY THE

Kennet S. Ka

Sponsors of the Uniform Plumbing Code™, Uniform Swimming Pool.

Spa and Hot Tub Code™ and Uniform Solar Energy Code™, Co-Sponsors of the Uniform Mechanical Code™.

TOTAL P.04



SENDER: Complete items or 2 for additional services.	l all wish to receive the
<ul> <li>Complete items 48 &amp; b.</li> <li>Print your name and dress on the reverse of this form so that we can return this card to you.</li> </ul>	folid services (for an extra fee):
Attach this form to the front of the mailplece, or on the back if space does not permit.	1. Addressee's Address
<ul> <li>Write "Return Receipt Requested" on the mailpiece below the article number.</li> <li>The Return Receipt will show to whom the article was delivered and the date.</li> </ul>	2.   Restricted Delivery Consult postmaster for fee.
Dave Allen Vice President, Manufacturing Hydro Air Industries, Inc. Cert 1317 W. Grove Avenue Drange, CA 92665 Date	icle Number 2 4 0 12 293  price Type istered   Insured  iffied   COD  ress Mail   Return Receipt for Merchandise
	ressee's Address (Only if requested fee is paid)

•

100



### FOR OFFICIAL USE ONLY

U.S. CONSUMER PRODUCT SAFETY COMMISSION
WASHINGTON, D.C. 20207

COPY

OFFICE OF COMPLIANCE AND ENFORCEMENT

APR 2 2 1994

Division of Corrective Actions Tel: 301-504-0608 Fax: 301-504-0359

Certified Mail

Dave Allen Vice President, Manufacturing Hydro Air Industries, Inc. 1317 W. Grove Avenue Orange, CA 92665

Re:

CPSC RP940116

Hydro Air Industries, Inc. Model 10-6200 Suction Fitting

Dear Mr. Allen:

Thank you for your telephone report of April 19, 1994 under section 15(b) of the Consumer Product Safety Act, as amended (CPSA), 15 U.S.C. § 2064(b). In your report, you indicated that your firm's model 10-6200 suction fitting was involved in an incident of hair entrapment that resulted in a near drowning.

Enclosed for your information are the Consumer Product Safety Act and the Commission's regulation entitled, "Substantial Product Hazard Reports," 16 C.F.R. Part 1115. These documents explain the Commission's authority and policy with regard to products which may present substantial product hazards and also explain the firm's rights and obligations under the Act.

One of the responsibilities of the Compliance staff is to determine preliminarily whether a defect is present in a product and, if so, whether that defect rises to the level of a substantial product hazard as defined by section 15(a) of the Consumer Product Safety Act (CPSA), 15 U.S.C. § 2064(a).

#### Information Requested

For the staff to assess accurately the potential hazard associated with the firm's product, if any, it requires certain

information from the manufacturer or importer of this product. Please provide the "Full Report" information specified by 16 C.F.R. § 1115.13(d) (1-14) on pages 35,001-02 of the enclosed Federal Register notice. In your response, please reference each question number (1-14).

In addition to providing the information requested in 16 C.F.R. §1115.13(d) (1-14), paragraph 15 of the "Full Report" requests any additional information needed by the staff. In accordance with paragraph 15 (see page 35,002), please also provide the following additional information:

- 15a. Copies of all test reports, analyses, and evaluations, including premarket tests and reports of tests and any analyses related to the reported problem. Include the date and place such tests and analyses were conducted by or on behalf of the firm and the identity of the persons involved in the testing and analyses.
- 15b. Copies of all engineering drawings, engineering change notices and material specifications relevant to the identified problem.
- 15c. The identity of the person(s) who identified the potential problem, the date he/she identified the problem, any persons they notified, and the date of notification.
- 15d. Concerning the information specified by 16 C.F.R. §1115.13(d)(6), please include a copy of all safety related consumer or dealer complaints, warranty claims, reports of injury, and copies of all documents related to such complaints, claims and injuries. Please include, copies of all court complaints and related documents filed in or associated with lawsuits involving the product and a description of the resolution of those lawsuits, if any.
- 15e. Provide two samples of the model 10-6200 suction fitting, instructions for proper installation, bulk head fitting and other fixtures that would assist in mounting the suction fitting. If there is a cost associated with these samples, notify us prior to sending the samples.

If the consumer complaints and the other documents requested in Paragraph 15d above are unavailable, please indicate the reason for such unavailability, and provide a summary of the requested items containing the name, address and telephone number of the claimant, or the name address and telephone number of the plaintiff's attorney.

#### Staff Assessment

After receiving the firm's response, the Commission's Compliance staff will make a preliminary determination as to whether it believes the product presents a substantial product hazard. See 16 C.F.R. § 1115.12(a). Therefore, it is of primary importance that the firm now provide all of the requested information so that the staff can make an accurate assessment of the potential safety hazard associated with the product.

#### Information Disclosure

The Commission often receives requests for information provided by firms under section 15(b) of the CPSA. Section 6(b)(5) of the CPSA, 15 U.S.C. § 2055(b)(5), prohibits the release of such information unless a remedial action plan has been accepted in writing, a complaint has been issued or a firm consents to such release. (See section 6(b) of the CPSA, as amended (enclosed)).

In addition to the above, if the firm submits any information that it considers to be a trade secret, or confidential commercial or financial information, it must mark it "confidential" in accordance with section 6(a)(3) of the CPSA, as amended, 15 U.S.C. § 2055(a)(3) and 16 C.F.R. § 1015.18. The Commission is prohibited from disclosing to the public information that is in fact trade secret or proprietary commercial or financial data. If the firm does not request confidential treatment at the time of its submission or within ten days thereafter, the staff will assume that it does not consider information in the submission to be a trade secret or otherwise exempt from disclosure under section 6(a) of the CPSA and the Freedom of Information Act, 5 U.S.C. § 552(b)(4).

#### Continuing Obligation

Please note that the firm has a continuing obligation to supplement or correct its "Full Report" as new or different information becomes known. For instance, if after filing the "Full Report" the firm receives or learns of information concerning other incidents or injuries, or information that affects the scope, prevalence or seriousness of the defect or hazard, it must report that information to this Division immediately.

The Division of Corrective Actions requests that the firm provide a response within 10 working days of your receipt of this letter. Please reference the CPSC file number in your response.

If you seek assistance or if you have any questions, you may contact Judith Hayes, Division of Corrective Actions, U.S. Consumer Product Safety Commission, 4330 East West Highway, Room 613, Washington, D.C. 20207-0001, telephone: (301) 504-0608, extension 1355. Thank you for your cooperation in reporting under section 15 of the Consumer Product Safety Act.

Sincerely,

Marc J. Schoem Director Division of Corrective Actions

#### Enclosures

Compilation of CPSC Statutes
Substantial Product Hazard Regulations
FOIA Regulations
Information Disclosure Sheet
Recall Handbook

CC: Consumer Product Safety Commission Western Regional Center 600 Harrison Street Room 245 San Francisco, CA 94107-1370

104

U.S. CONSUMER PRODUCT SAFETY COMMISSION

TO

WESTERN REGIONAL CENTER 600 HARRISON STREET, ROOM 245 SAN FRANCISCO, CA 94107

	7	FAX (415)	15) 744-2966 744-2962	0.2	11th
date: <u>5</u>	/7/26		· ··\	ORGANIA 28	
то:	TUDY	MARE	<u> </u>	ORGANI	ZATION
FROM:	Lecen	IBAIC	างม	011012	
				ORGANIZ	ZATION
SUBJECT: _	HYI	DPO	AITC	FOTZ	SP
<del>-</del>					
NUMBER OF	F PAGES:	30		+COVER	
REMARKS:					
			•	·	·
					,

	FIFI D A	CTIVITY CO	VERSHEET			
1. REGION/STATE FOWR/LOS	2. OPERATION (Check One) ( ) Inspection ( ) Telephone Contact ( ( ) Other [	( ) Estab	lishment Visit	3. DATE March 19, 1996 4. NUMBER (For RO Use)		
5. ESTABLISHMENT Name , Beachp Address Unknown City Unknown	own ]	Phone		960228CWE6001		
ELATED FIRM ( ) I		. ( ) Subsi	ldiary (X) Other			
7. PRODUCTS COVERED Residnatial Spa Spa Suction Cover			a. OTHER CONSUMER N/A	PRODUCTS		
9. ESTABLISHMENT TYPI (X) Manuface ( ) Wholesaler ( ) Reialler ( ) Other [	turer () Importer		10. ANNUAL PRODUCT Product Covered \$ Other Products \$	. Units [		
11. I.S. BUSINESS % Received [ ] % Shipped [ ]	12. SAMPLES COLLECTED N/A		13. MIS CODE 12165	14. HOURS Activity 19 Travel 4.5		
15. REASON FOR ACTIVITY F/U to task number 9						
	Rationale for Announced Inspection )N/A					
17. EMPLOYEE'S NAME Keven Barton		TITLE Invest.	SIGNATURE			
This investigation inv in a suction drain fitti	ng of a spa. The spa was prior to the purchase of the in cover.	who expired from located at the h	n drowning. The viction of the victim's parandoarents in 1982	m's hair becamed entrapped grandparents. The spa wer the suction drain fitting was		
19. REVIEWER'S NAME Joel C. Swisher		TITLE Act. Sup.	SIGNATURAL			
20. REVIEW DATE 4/18/96	21. DISTRIBUTIONO: EPDS, co	:: LOS IDI Piles es: L	Barier, il Cornell (amis)			

			·					
1. CASE NO. 960228CWE6001		-	TIGATOR'S TO [0][3][5]	3. OFFICE [8]	[6 ][0 ]			MIOLOGIC STIGATION
4. DATE OF INCIDENT! [9 ][6 ][	NO DAY 0 ][2 ][2 ][5 ]		NVESTIGATION ED	YR [9][6]	MO DAY [0 ][3 ][1 ][9 ]		_	EPORT
6. SYNOPSIS OF INCIDE her shoulder length b						drowni	ing in the	famlies backyard spa after
7. LOCATION (Home, s Backyard		a. crry Huntingt	on Beach	•		9. STAT	ΓE	
10A. FIRST PRODUCT Home Spa	[0 ][6 ][9	][8]	11A. TRADE/BI Possible Manu No additional	ufacturer i	s Beachport S	pa,	ANUFACT	TURER & ADDRESS
108. SECOND PRODUC Suction Cover	T COOL	]	11B. TRADE/M Hydro Air, A			uber, M.	ANUFACT	URER & ADDRESS
12. AGE OF VICTIM [0 ][1 ][2 ]	13. SEX (USE MALE - 1 FEMALE - 2	[2]	14. DISPOSITION Died [8]			15. MURY DIAGNOSIS Drowning [6][9]		
16. BODY PART [8 ][5 ]		·	NT(S) (Mother, Fr adfather [2]	ierd)	18. TYPE INV ON SITE - 1 TELEPHONE - OTHER - 3		(1 )	19. TIME SPENT [2][3].[5]
20. ATTACHMENTS Multiple	[9]	21. CASE	<b>SOURCE</b> [0 ][5 ]		22. REVIEWE [ 8][0 ][9 ][		Ý	R MO DAY [ 9][6 ][0 ][4 ][1 ][8 ]
23. Permission to Di (NON-NEISS (	sclose namei Cases only)		Y DISCLOSE MY	NAME [				IY NAME [XX ]
24. NARRATIVE (See L	setructions on P	ogo 2)			25. REGIONA	L OFFICE	DIRECTO	OR REVIEW DATE

TO

The partative report and exhibits are attached.

USE ADDITIONAL SHEETS & NECESSARY)

SC FOR NO. 182 (Revised 10/95)(Adapted for NP for Windows & Epson LQ-1170 Printer 10/95)

IDI: 960228CWE6001 Keven Barton (9035) March 19, 1996 Page #2

The information contained within this report was provided by the victim's father and grandfather. Additional information was obtained from official reports.

#### Pre-Event:

The victim was described by her father as a healthy and active 12 year old female, who weighed 91 pounds and was 61" tall. According to the victim's father his daughter loved the water and was a very good swimmer. The victim had lived in Hawaii for eight years, during which time she snorkeled and swam in the ocean. She also swam in swimming pools, and had been in various spas and hot tubs. The victim and her father had been residing in another state and were vacationing at the home of the victim's grandparents in California.

The victim had straight blond hair which was just past her shoulders. The father said that her hair was fine but she had lots of it.

According to the victim's grandfather when he purchased his residence two years ago there was a fiberglass spa in the backyard. The spa was similar in looks and design to a portable unit except that it was recessed into the ground and surrounded by a wooden deck, photographs \$1-8, exhibit \$8. The mechanical units (filter, pumps, heater) were located approximately 23 feet from the unit. An "L" shaped wooden fence partially obstructed the view of these components, photograph \$2, exhibit \$8. The spa was seldom used by the victim's grandparents, and did not require any professional servicing or repairs. The grandfather regularly cleaned the spa and tested the water for proper chemical levels. The filter, and the leaf catchers in the pump and blower units were cleaned as needed. The built-in light required resealing which was done by the victim's grandfather. No other servicing was required or conducted.

During her two week stay at her grandparents home, the victim was always asking if she could swim in the spa. She was allowed to do so on one occasion for approximately 10 to 15 minutes. However, the victim continued asking if she could go into the spa again. Sunday, February 25, 1996, was the last day of the victim's vacation. Her grandfather cleaned the spa in case her father allowed her to use it. At approximately 7:00 p.m. the family finished their evening meal. They retired to the garage to play cards with other family members who were present. At approximately 7:30 p.m. the victim's father allowed her to use the spa. The victim's grandfather went to the backyard with her and turned on the spa and the underwater light.

IDI: 960228CWE6001

TO

Keven Barton (9035)

March 19, 1996

At approximately 7:50 p.m. the victim's grandmother went to the bathroom. There is a window in the bathroom which overlooks the spa. The grandmother looked out the window and did not see nor hear the victim. She advised her husband, and they searched the house and backyard. The spa was still operating but there was no sign of the victim. The grandfather turned off the spa and its light and returned to the garage. They advised the victim's father that the victim was not in the spa and could not be found. The victim's father looked in the yard and checked with several neighbors to the West. Approximately 8:00 p.m. the victim's father looked into the spa again. He was concerned because the victim's sweat pants and towel were still on the wooden deck next to the spa.

#### Event:

When the grandfather turned on the spa light they saw the victim face up with her head apparently attached to the spa drain.

#### Post-Event:

The suction drain is located on the side of the spa near the bottom. Both the father and the grandfather jumped into the spa, but were unable to remove the victim. A pair of scissors were obtained, and after about three to four attempts the father was able to free the victim.

The victim's grandmother had already phoned 911 emergency and the family began CPR until the paramedics arrived. The victim was transported to a local hospital and was pronounced dead at 2043 hours on February 25, 1996. Cause of death was listed in the coroner's summary as fresh water drowning. Blood alcohol level was 0.00%.

According to the father, the grandparents may not have originally seen the victim in the spa because of the bubbles created by the jets. Also the victim was wearing a brown colored swim suit which was similar in color to the spa.

#### Product Identification:

Efforts to identify the manufacturer of the spa were unsuccessful. There were no identifying labels or marks which could be traced to a specific manufacturer. A logo was cast into the fiberglass on the bottom of the spa. This was copied and shown to several spa retailers, but the identity of the spa manufacturer could not be identified. A copy of the logo design is appended as exhibit number one.

IDI: 960228CWE6001 Reven Barton (9035) March 19, 1996

A copy of the city building permit was obtained from the city building department. The owner builder permit appears to be dated November 29, 1982, and is for a Beachport Spa. A review of the 1996 North Orange county yellow pages, the 1992 Business to Business phone directory, covering Orange, Inland Empire and San Diego County, and the 1996 greater Los Angeles yellow pages failed to reveal a listing for Beachport Spas.

TO

It is unknown if any of the components were professionally installed, since the permit indicates an owner builder.

A private investigator working for the families attorney claimed that Beachport Spas was once located in San Clemente, CA. However, a check with directory assistance failed to reveal a listing. The investigator advised that he has been unsuccessful in locating a company named Beachport Spas.

The spa is approximately 85" outside and 73" inside diameter, 36" deep, has eight sides and seven jets and molded seats. The jets appear to be adjustable. There is a light mounted on one of the sides near the bottom. The suction cover was removed by the police and fire department and held as evidence. The suction cover was mounted on the side of the spa near the bottom of two steps that lead into the spa.

The controls for the filter, blower, jets, light, and heater are mounted on the outside wall of the house approximately 7'-6" to 8' from the spa and about 4' from the top of the deck, photographs #5-6, exhibit #8. According to the victim's uncle the spa light, heater and jets were turned on at the time of the incident. The pump and filter are 220v and the blower is 120 volt.

The suction cover was in the possession of a private investigator working for the families attorney. I met with him and examined and photographed the cover. The cover was manufactured by Hydro Air, and had the code sequence of p/n 10-6200 and the initials U.S.P.C. The cover was about 6" in diameter and the threaded portion for connecting to the spa was about 2-7/8" in diameter. No other identifying marks could be located. There were no obvious signs of the cover or other components being tampered with, photographs #15-18, exhibit #8.

It is unknown if the pump, blower, filter or heater had ever been replaced. The grandfather had never replaced any of the units in the two years he has owned the home.

TO

IDI: 960228CWE6001 Reven Barton (9035) Karch 19, 1996

#### Product Identification:


Filter Pump:



Motor for Filter Pump:



Heater:

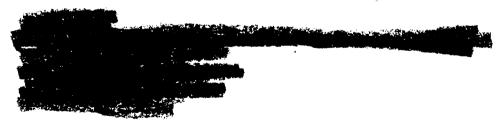

Filter:



IDI: 960228CWE6001 Keven Barton (9035) March 19, 1996

#### Product Labeling:

The spa contained two labels located on the upper portion of the spas side just above the first step. The labels read:

TO

1. Photograph #15, exhibit #8.

WARNING DO NOT EXCEED 104

Photograph #14, exhibit #8.

#### CAUTION


The Consumer Product Safety Commission has stated that water temperature in a spa or hot tub should not exceed 104F immersion in water in excess of 104F could be hazardous to your health, children, aged persons, persons having medical problems and pregnant women should consult their physicians before using a spa or hot tub. Spa or hot tubs should not be used by persons under the influence of alcohol or by persons taking medication which induce drowsiness.

No other identifiable markings could be located on the unit.

#### Exhibits:

- 1. Drawing of spa logo.
- 2. Copy of building permit.
- Police report.
- 4. Fire and Paramedic report.
- 5. Coroner summery report.
- 6. Catalog for Hydro Air pump.
- 7. Copy of Los Angeles Times article provided by grandfather.
- 8. Photographs and Negatives.
  Authorization for release of name.
  Assignment.

913015040359 P.10 LT3 3/21/96 960:008046606

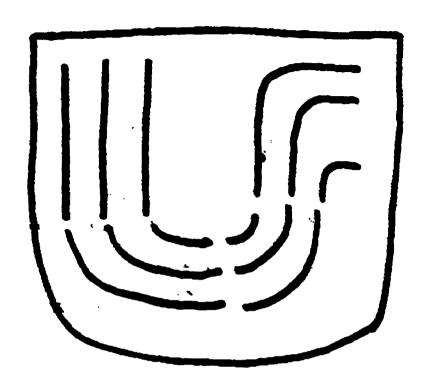

KIB 4/3/9B 960778CGE6001

## **SWIMMING POOL PERMIT**

CITY OF HUNTINGTON BEACH DEPARTMENT OF DEVELOPMENT SERVICES P.O. BOX 190 - CALIFORNIA 92648 FEES (714) 535-5241 Bullding Permit Building Man Check P.C. Addies Conservation Block No. Tract Rumping Electrical ABOVE tom Fixtures Switches Contractor CUNER .SO Outlets Address 2.40 Motors MP = 0 to 1 City Tel. No. 6.00 Over 1 to 5 Ståte Lic. Na. City Lic. No. Time Clock UCC Costal Permit Zone Alterino Service 13.60 NO 6.00 Sub Panel Remarks Issuance Fee 10.00 TOTAL FEES 7.0 Area of Post SPA Valuation I have read the application and some to compty with all local and state laws applicable to building concruction.

It I am validly registered and licensed as required by the City of Huntington Beach and the base of California, or 7.

2. I am the legal owner of the above described property. 1. 2. 2 am the legal owner of the above sessibled property.

1. have filed with the City of Munington Reach:

2. A certificate of consent to sethinsure issued by the Director of Industrial Relations, or

2. A certificate of workers' compensation insurance (saued by an admitted insurer, of

3. An exact copy or duplicate thereof certified by the Director or the insurer, of

4. I certify that in the performance of the work for which this permit is issued, I shall not employ any person in any manner so as to Decome subject to the workers constitutionally have of the State of California.

I certify for declared under thematic of declared that the idequality is true and correct, and this declaration was executed on the 2.9-divided. APPROVALS Date 'aspector Rough Electric Rough Rumpina If work is not commenced 180 days from date of issue of this sermit, or if work is abandoned for more than 180 days, this permit as Test PTID shall be null and vold Elect. Final Land Use App Poncing - Gate Permit Authorized Date O.K. to Plaster Permit Issued By Pool Final, J-Boxes, Cover Beceipt No.

Harry Brut On

15

CPSC/FOWR

TO 1071 W. SANTA ANA BLVD. SANTA ANA, CA 92703

913015040359 P.02 760278066001

RAD GATES SHERTEF-CORONER

CASE SUMMARY

DECEDENT:

CASE NO.: 96-01341-WU

· PD: HBPD

RESIDENCE:

CITY:

Hous ton

STATE: TX 77080

DR: 96-04443

AGE:

12 years

DOB: 06-22-83 RACE: White

SEX: Female

OCCUPATION:

Student

RELATIVES:

Father:

ADDRESS: CITY/STATE:

Huntington Beach, CA 92649

CLASSIFICATION:

Accident

SUBCLASS CODE: MECAP

DATE OF DEATH:

02-25-96

DATE OF INJURY: 02-25-96

TIME OF DEATH:

2043 hrs.

TIME OF INJURY: Unknown hrs.

PLACE OF DEATH:

Huntington Beach Medical Center

ADDRESS:

17772 Beach Blvd.

CITY:

Huntington Beach, CA 92647

INJURY MODE:

Spa

INJURY TYPE:

Drowning/spa/private residence Private residence/backyard spa

INJURY SITE: INJURY ADDRESS:

4952 Maui Circle

INJURY CITY:

Huntington Beach

ADMITTED FROM:

Private residence

ADDRESS:

CITY:

CAUSE OF DEATH: Fresh water drowning

OTHER COND.:

None

INVESTIGATOR: PATHOLOGIST:

CHRISTY L. WURSTER

Joseph J. Halka, M.D.

AUTOPSY DATE:

02-26-96

TOX RETURNED: 03-14-96

MICRO RETURNED:

DRUGS FOUND PRESENT IN SIGNIFICANT LEVELS:

B/A LEVEL

0.00%

BENZOYLECGONINE COCAINE

N N

DATE CERTIFICATE ISSUED:

02-26-96

MORPHINE CODEINE

N N

N

CE

METHAMPHETAMINE

OTHER DRUGS POISON

N N N DATE CERTIFICATE AMENDED:

# Draw your own conclusions.

THE MARIAH AIR PUMP:

a new direction for blowers.

Hydro Air Industries—the new idea company—is making history with the revolutionary Mariah Air Pump, today's standard of excellence. It's not just another air blower, but the first air pump with a self-cooling bypass motor that eliminates overheating and water damage, and permits trouble-free performance year after year.

Developed specially for spas and hot tubs, the Mariah's unique motor design provides the industry with a new measure of safety, and an end to

r warranty problems. Universal intion of the unit (side or bottom c... its) requires plumbing connections of only 11/2.

If you've put up with blower problems long enough, you're ready for the Mariah Air Pump. For details, contact us at Hydro Air Industries—the new idea company.

A. Air is drawn in under the tid and down the air Intake tube, rather than over an electric motor as in conventional blower designs. Overheating is eliminated.

8. With the Marianic peripheral discharge design, air from the intake tube is pumped through the impellers (stages) and released out the louvered side of the unit.

C. The gasket seal is watertight,

D. The Mariah incorporates the first air pump motor designed specifically for the spechot tub industry. The electrical component is safely located in the upper level to prevent water damage and the possibility of electrical shock in the event condensation or water backflow enters the air chamber. The motor has its own cooling system, unlike conventional units which depend on the air flow to retard overheating.


- E. Thermat overload protection prevents overheating or damage to the unit during long runs and extended use.
  - F. Acoustical form insulation ensures quiet operation.
  - G. Junction box, switch, and clear Lexan cover included.
  - H. Side Installation option,

THE NEW IDEA COMPANY

HYDRO AIR CINDUSTRIES INC.



1317 W. GROVEAVE., ORANGE, CA 92665 (714) 974-1920

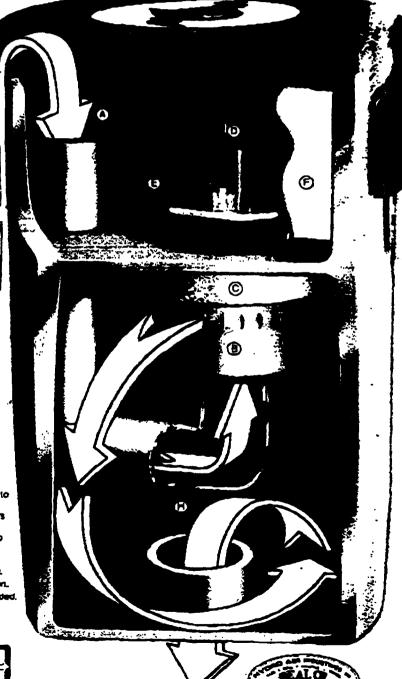


**6** 

MODEL NO.	STAGES	VOLTS	MAX. Amps	MAX. PSI	MAX	WATER DEPTH	FLOOR HOLES # 3/16"	-OR-	FLOOR HOLES@1/8"	SEAT HOLES @ 1/4	NO. VENTURI'S
12-1201	1	120	7.2	2.3	153	24"	18		16	35	4-6
12-2401	7	240	3.8	2.3	144	30"	15		13	27	4-6
12-1202	5	120	9.1	4.1	105	24"	30		45	45	6-10
						30	26		39	40	6-10
12-2402	Z	240	4,1	4.1	97	36"	22		33	36	6-10
						48"	19		27	32	6-10
12-1203	3	120	9.8	4.8	90	24"	33		50	50	8-12
						30"	29		43	44	<b>8</b> -12
12-2403	3	240	4.3	4.8	86	<b>36</b> "	25		36	40	8-12
						48"	21		30	35	8-12

- 1) CALCULATIONS ARE FOR A 25' RUN USING 11/1" PVC PIPE AND TWO (2) NINETY DEGREE ANGLES. FOR LONGER RUNS. DECREASE QUANTITY BY 10% FOR EACH ADDITIONAL TEN FEET AND 5% FOR EACH ADDITIONAL NINETY DEGREE ANGLE.
- 2) FOR INCREASED ACTION OR IF MORE HOLES THAN LISTED ARE DRILLED, IT MAY BE NECESSARY TO USE TWO AIR PUMPS.
- 3) CALCULATE DEPTH OF WATER TO HIGHEST LEVEL IN SPA.
- 4) IF FEWER HOLES THAN LISTED ARE DRILLED, THE AIR PUMP WILL STILL FUNCTION AS LONG AS A MINIMUM OF 20 3/16" HQLES ARE DRILLED IN THE FLOOR OR SEAT.

#### MARIAH 120/240 VOLT RESIDENTIAL AIR PUMP FLOW CHART

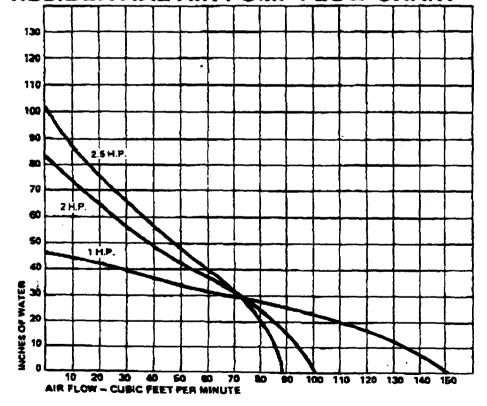

#### AIR PUMP USAGE

- 1 H.P. As an air boost for six (6) jets or for air induction on spas/hot tubs less than 30" deep and 5' x 5' or 25 square feet of surface area.
- 2 H.P. As an air boost for six (6) to eight (8) jets or for air induction on spas/hot tubs tess than 50" deep and 8' x 8' or 70 square feet of surface area.
- 2.5 H.P As an air boost for eight (8) to ten (10) jets or for air induction on spas/hot tubs less than 60" deep and 10' x 10' or 100 square feet of surface area.

//8

<sup>\*</sup>NOTE: If the air line consists of more than thirty five (35) lineal feet of pipe, a larger size air pump should be used.

# Draw your own conclúsions.

TO

THE MARIAH AIR PUMP:

a new direction for blowers.

Hydro Air Industries—the new idea company—is making history with the revolutionary Mariah Air Pump, today's standard of excellence. It's not just another air blower, but the first air pump with a self-cooling bypass motor that eliminates overheating and water damage, and permits trouble-free performance year after year.

Developed specially for spas and hot tubs, the Mariah's unique motor design provides the industry with a new measure of safety, and an end to

r warranty problems. Universal intion of the unit (side or bottom
c. ...ts) requires plumbing connections only 11/2."

If you've put up with blower problems long enough, you're ready for the Mariah Air Pump. For details, contact us at Hydro Air industries—the new idea company.

A. Air is drawn in under the lid and down the air intake tube, rather than over an electric motor as in conventional blower designs. Overheating is eliminated.

2. With the Marianis, peripheral discharge design, air from the intake tube is pumped through the impellers (stages) and released out the louvered side of the unit.

C. The gasket see! Is watertight.

D. The Mariah incorporates the first air pump motor designed specifically for the spathot tub industry. The electrical component is safely located in the upper level to prevent water damage and the possibility of electrical shock in the event condensation or water backflow enters the air chamber. The motor has its own cooling system. unlike conventional units which depend on the air flow to retard overheating.

E. Thermal overload protection prevents overtigating or damage to the unit during long runs and extended use.


- F. Acquatical form insulation ensures quiet operation.
- G. Junction box, switch, and clear Lexan cover included.
- H. Side installation option.

THE NEW IDEA COMPANY

HYDRO AIR



1317 W. GROVE AVE., ORANGE, CA 92665 (714) 974-1920

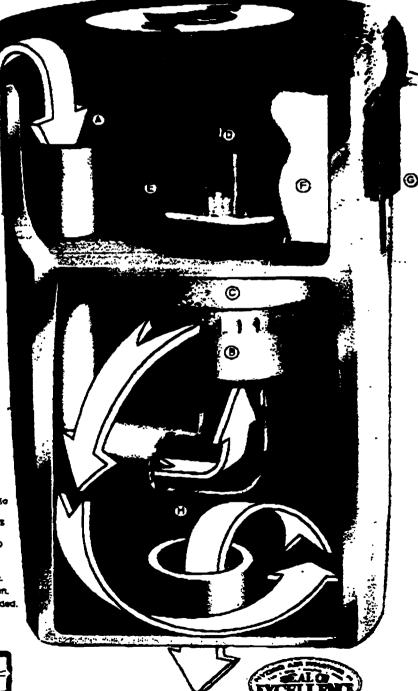

MODEL NO.	STAGES	VOLTS	MAX. AMPS	Max. PSi	MAX	WATER	FLOOR HOLES@3/16	-QR-	FLOOR HOLES @ 1/5"	SEAT HOLES @ 1/5"	NO. VENTURIS
12-1201	1	120	7.2	2.3	153	54"	18		16	35	4-6
12-2401	1	240	3.8	<b>Z</b> .3	144	30"	15		13	27	4-6
12-1202	2	120	9 1	4,1	105	24"	30		45	45	B-10
						30	26		39	40	6-10
12-2402	2	240	4.1	4.1	97	36	22		33	·· -36	5-1Q
						45"	19		27	32	6-10
12-1203	3	120	9.8	4.8	90	24"	33		50	50	8-12
						30,	29		43	44	8-12
						30,	29		43	11	<b>8</b> -12
15-1502	2	120	9.8	4.8	28	24-	33		50	50	8-1 <b>S</b>
		- 24:		<u> </u>	. ::	£2.	\$\$ ::		1	-=	#1# #1#
<u> </u>	•		· •	<i>=</i> :			::		7.7		2.2

•

.

TO

# Draw your own conclusions.

THE MARIAH AIR PUMP:

a new direction for blowers.

Hydro Air Industries—the new idea company—is making history with the revolutionary Mariah Air Pump, today's standard of excellence. It's not just another air blower, but the first air pump with a self-cooling bypass motor that eliminates overheating and water damage, and permits trouble-free performance year after year.

Developed specially for spas and hot tubs, the Mariah's unique motor design provides the industry with a new measure of safety, and an end to

r warranty problems. Universal intion of the unit (side or bottom c.. .ts) requires plumbing connections only 11/2!

If you've put up with blower problems long enough, you're ready for the Mariah Air Pump. For details, contact us at Hydro Air industries—the new idea company.

A. Air is drawn in under the lid and down the air intake tube, rather than over an electric motor as in conventional blower designs. Overheating is eliminated.


- II. With the Marianis, peripheral discharge design, air from the intake tube is pumped through the impellers (stages) and released out the louvered side of the unit.
  - C. The pasket sent is watertight.
- D. The Marish incorporates the lirst air pump motor designed specifically for the spethot tub industry. The electrical component is safely located in the upper level to prevent water demage and the possibility of electrical shock in the event condensation or water backflow enters the air chamber. The motor has its own cooling system. unlike conventional units which depend on the air flow to retard overheating.
- E. Thermal overload protection prevents overhealing or damage to the unit during long runs and extended use.
  - F. Acoustical form insulation ensures quiet operation,
  - G. Junction box, switch, and clear Lexan cover included.
  - H. Side installation option.

THE NEW IDEA COMPANY

HYDRO AIR (



1317 W. GROVE AVE., ORANGE, CA 92665 (714) 974-1920

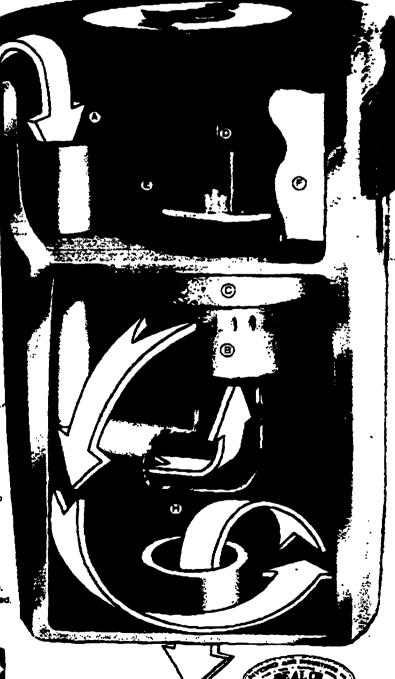

P.01

## CPSC/FOWR


#### MARIAH AIR PUMP SIZING CHART

TO

MODEL NO.	STAGES	VOLTS	MAX. AMPS	MAX. P\$I	MAX	WATER DEPTH	FLOOR HOLES@3/16"	-OR-	FLOOR HOLES @ 1/8"	SEAT HOLES@1/5	NO. VENTURIS
12-1201	1	120	7.2	2.3	153	24"	18		16	35	4-6
12-2401	1	240	3.8	2.3	144	30"	15		13	27	4-6
12-1202	5	120	9.1	4.1	105	24"	30		45	45	6-10
						30"	26		39	40	6-10
12-2402	2	240	4.1	4.1	97	36"	55		33	36	6-10
						48"	19		27	32	<b>6-10</b>
12-1203	3	120	9.8	4.8	90	24"	33		50	SO	8-12
						30"	29		43	44	<b>5-12</b>
12-2403	3	240	4.3	4.8	86	36"	25		36	40	8-12
						48"	21		30	35	8-12

- CALCULATIONS ARE FOR A 25" RUN USING 11/1" PVC PIPE AND TWO (2) NINETY DEGREE ANGLES. FOR LONGER RUNS, DECREASE QUANTITY BY 10% FOR EACH ADDITIONAL TEN FEET AND 5% FOR EACH ADDITIONAL NINETY DEGREE ANGLE.
- FOR INCREASED ACTION OR IF MORE HOLES THAN LISTED ARE DRILLED, IT MAY BE NECESSARY TO USE TWO AIR PUMPS.
- CALCULATE DEPTH OF WATER TO HIGHEST LEVEL IN SPA.
- IF FEWER HOLES THAN LISTED ARE DRILLED. THE AIR PUMP WILL STILL FUNCTION AS LONG AS A MINIMUM OF 20 3/16" HOLES ARE DRILLED IN THE FLOOR OR SEAT.

## **MARIAH 120/240 VOLT** RESIDENTIAL AIR PUMP FLOW CHART

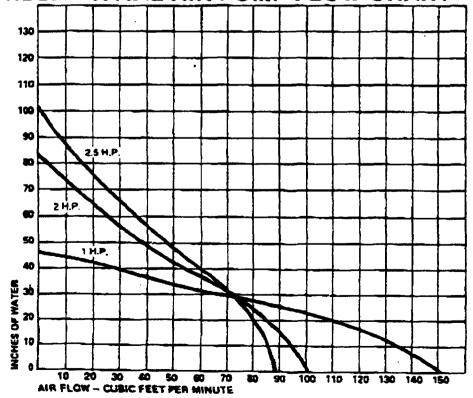

### AIR PUMP USAGE

- 1 H.P. As an air boost for six (6) jets or for air induction on spas/hot tubs less than 30" deep and 5' x 5' or 25 square feet of surface area.
- 2 H.P. As an air boost for six (6) to eight (8) jets or for air induction on spas/hot tubs less than 50" deep and 8" x 8' or 70 square feet of surface area.
- 2.5 H.P As an air boost for eight (8) to ten (10) jets or for air induction on spasihot tubs less than 60" deep and 10' x 10' or 100 square feet of surface area.

<sup>&</sup>quot;NOTE: If the air line consists of more than thirty five (35) lineal feet of pipe, a larger size air pump should be used.

cus

wit L

the

dea mo

An

Zen NB.

stor

OUP

clos .

NR

heir

B

ONE

Dian

Com

mon.

Prin

earn

the

esta

ينلحم

clud

ncha

tearr

regi

ache

szid.

30 L

fami

ofter

irom

dent. stud:

in ter

~F

Distinguished Service

THE STATE

Schoen, 31, was honored for catching a fleeing suspect who allegedly fired a handgun at another officer out felled to hit him.

Officers learned later that the transfer was a percent who had been involved in a pur battle with Los drightes being the deputes in 1960.

Rudial. 20, and Flunter, 28, were incomed for their afforts in treating up a ring of robbies who stole from plans delivery people. Posing at plans delivery people, Posing at plans delivery people, the officers were dispatched to a residence in the 200 block of Wag. Valetick Drive, where they were captromed by two men who tried to rob them and fired several gun shots at Rudial.

The two officers, who were not injuried returned fire. The suspecia fied but leter were accepted.

Potts, 33, was present for his efforts, both an and off duty, to presenting framing programs for fellow officers and the Special Waspons and Tactice (SWAT) Team

#### COUNTYWIDE

### Cypress College Cites Couple for Generosity

Business owners Law and Margaret Welth are Cypress College's Americans Mariand Woman, of the Year The Welth, who operate

The Webb, who operate eight our dealerships in Orange and Let Angeles exhibits were honored by the college for their work in several service arguments in the facilities and for their flastical apport of

community groups

Raciotimis of the Laguin
Hills existic a setternett
Instate that American
Cancel Sectory St Mary
Medical Cover Pourstation
Case Youth Sheller and
Mission Hills Chirotic

خلان نم نسا ہو۔

MUNTINGTON BEACH .

# Spa Warnings Reiterated Following Girl's Drowning

The weekend drowning of a 12-year-old girl whose hair got sucked into the vent of a hot tub has prompted renewed warnings about the dangers of spas, especially the older single intake-type built before the enactment of safety codes.

"I've seen several of these [accidents] and every one of them happened in an old-style spa," Donaid Boland, a spokesman for the Huntington Beach Fire Department/said Monday of the drowning of the drowning of the drowning of these; it's not like a car accident. These are the things that stick in your mind."

The accident occurred Sunday night at the home of superior of grandparents on where she and her parents were visiting from their home in Houston.

The girl was in the spa alone about 8 p.m., Boland said, when her hair was apparently sucked into an intake vaive, and she was pulled underwater.

By the time relatives had cut her hair to free her, the fireman said, she had lost consciousness. She later died at a hospital.

The incident closely resembled

another in Villa Park just seven months ago that nearly took the life of the 6-year-old son of former Ram player Greg Meisner. In that case, however, Meisner was able to save the boy's life by wrenching him free of the drain, which left a 10-inch-diameter bruise on the youngster's back.

The drowning of a 9-year-old boy in 1978 prompted county officials to begin requiring two vents rather than one in all spas built in unincorporated areas. Designing spas with two vents, said Larry Nees, manager of building inspections for Orange County, significantly decreases the amount of suction in each one.

The county also began requiring that vents be covered and constructed in a manner designed to prevent hair or body parts from being suited in.

parts from being pulled in.
Huntington Beach, 'where
Sunday's drowning occurred,
eventually adopted similar
standards, said Bill Grove, the
city's inspection manager, but
not in time to affect construction
of the spa in which Sunday's
accident occurred.

-DAVID HALDANE

## **Spa Safety**

Here are some precautions to keep in mind if you own a spa-

- Avoid problems with a single drain by installing a second one to disperse suction.
- w install eafety dome on flat drains.
- w instruct anyone with long hair not to get it near a drain, and tell anyone who uses your spa not to stick fingers, toes or other body parts into drain.
- 2 Place power switch nearby so it can be reached quickly in case of emergency.
- 9 If your spe is indoors, lock the door to the room or use a cover that locks.
- w Closely supervise children, even if they know how to swim.
- w Wyer are conserned about a spa's safety, check with a building inspector.
- For more information, call the Orange County chapter of the National Spa and Pool Institute, (714) 832-1113.

Bourcost: Madland Spp and Post Institute: Children's Heaptyl of Grange County

DR Number 96-004443

Date of Report: 02/25/96

## HUNTINGTON BEACH POLICE DEPARTMENT CASUALTY REPORT

Code Offense :	Description DEATH REPORT		··· <u>·</u>
Date Occurred: SUN 02/2 Or Between: SUN 02/2 Discovered: SUN 02/2 Reported: SUN 02/2	25/96 at 20:10 25/96 at 20:10		
Location: At or Near: Name of Place: RD: 155	Beat: 10		
CRIME SCENE INVESTIGATION	אכ		<del></del>
CSI Conducted: Y by L.	DZIEDZIC	PIN 0677	
INVESTIGATIVE ANALYSIS			
Can the suspect vehicle was there significant or Is there identifiable Is there significant Is there significant Is there significant Is there good probabil Is this a contact that any associated	serious injury ? Y stolen property ? N : Modus Operandi ? Y sysical Evidence ? Y : ity of solution ? N : itinuing problem ? N	Are there any ID numbers ?	
Officer A. GREENBURG	PIN 1061	Supervisor \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	· ·
Page 1		Date	<u>56</u>
TYPED BY: P. BROWN HBPD FORM OFFENSE (rev.	420805 12/91)	96-00444 printed on 02/26/96 at	

# HUNTINGTON BEACH POLICE DEPARTMENT CASUALTY REPORT

TO

Date of Report: 02/2	25/96			DR Number	96-004443
PERSONS INVOLVED					
Involvement: VICTIM Name: Address: Home Phone: Occupation: STUDENT	Work	Phone	06/22/83 HOUSTON	Age Range:	TX 7708G
Employer Address: Relationship:	Interviewed?	Can :	ID? Supp	ort Prosecut	ion?
Involvement: FINDER Name: Address: Home Phone: Occupation: Employer Address: Relationship:	Work Interviewed? Y	DOB: Phone Emplo	byed by:	Age Range:	TX 77080
Involvement WITHISS Name Address: Home Phone: Occupation: CAR SALE Employer Address:	Work	Sex: DOB: Phone: Emplo	M Race: 11/06/43 HUNTINGTON byed by:	Age Range:	CA 92649
Details:			J-pp	ort frogetti	
	e evidence report	, same	e DR number.		
On 02-25-96, at 2011 received the call and one minute after I was	was approximately and responded code	two i	plocks from t	he location	when I
Upon my arrival, I we the rear yard, I say in-ground jacuzzi. If in an easterly direct doing CPR. I also sidentified by Office	was lying ction. I saw her saw a female doir	lying on the father common com	on the wood ne ground on er, with pressions on the	deck adjace her back, w Y, leaning	nt to an ith her head gover ====================================
Officer A. GREENBURG	P1	N 106	L Super	visor	[W]
Page 2			Date		2/26/96
TYPED BY: P. BROWN HBPD FORM OFFENSE (I	/420805 (ev: 12/91)	· · · · · · · · · · · · · · · · · · ·	pr	inted on 02/	96-004443 26/96 at 12:

Date of Report: 02/25/96

DR Number 96-004443

# HUNTINGTON BEACH POLICE DEPARTMENT CASUALTY REPORT

TO

As I approached that she was not checked and saw that she was not had vomited.	I noticed to breathing a	that she was blue in and had no pulse. I	color. I also noted that
I then removed my portable CPR means airway and relieved and relieved and relieved are removed to do two properties are removed. I then contour and removed arrived. I then contour with CPR, until Huntington B to Huntington Beach Medical Cent	erson CPR will continued to asset Ambular	rom doing CPR on hi th the female that the CPR until Huntin	.s daughter, was already agton Beach Medic
After was transpulled was transpulled back into the backyard an jacuzzi was an approximate 7 foo deck around it. I noticed that just west of the jacuzzi. I also the jets had been turned off. I scissors with orange handles resigated jacuzzi. I then noticed a large drain cover, also on the east was mately one foot from the bottom CSI report and additional suppleto the location.	d examined to octagon shift octagon shift octagon shift on the imass of broadle of the jacut	the jacuzzi area. In aped in-ground jacu cover was lying on at the jacuzzi lighted the jacuzzi and seat at the east enown hair stuck in whicuzzi, below the seati. For further design appears to the seating the seating and the seating appears to the seating appears the seating appears to the seating	saw that the azzi, with a wood the wood deck, at was on, but saw a pair of ad of the at looked like a eat, approxitable, refer to
I then spoke with	the father	of white	
Huntington Beach on vacation, st parents at the second state of the second seco	aying with	parent's,	e grand-
was unsure of the exact time, was asked if she could take a jacuzz then went into the back turned the jacuzzi heater on for	i.	I had just finished have said that his moved the cover of t	1945 hours, he dinner and stepfather, the jacuzzi and
jacuzzi. and i	was and	said that she was then went out, o while	not in the checked the walked out to
Officer A. GREENBURG	PIN 1061	Supervisor	m
Page 3		Date	2/26/96
TYPED BY: P. BROWN /420805 HBPD FORM OFFENSE (rev. 12/91)		printed on	96-004443 02/26/96 at 12:1

## HUNTINGTON BEACH POLICE DEPARTMENT CASUALTY REPORT

TD

pare or kep	ort: 02/25/9	<b>b</b>		L	K NUMB	er 3	-40444	2
			 <u>-</u>					·
						_		

interior of the house for them went back inside the house and checked the entire interior of the house for the Country Unable to find her, he decided to go out into the backyard and double check the jacuzzi for the country of the c

He walked back in the backyard again, this time with his stepfather, turned on the jacuzzi light, at which time in noticed Krista HUMPHREY face up in the bottom of the jacuzzi with her head pointed in an easterly direction. The post of the pool, but was unable to due to the fact that her hair was caught in the drain of the jacuzzi. He then yelled for someone to get him a pair of scissors. The pool brought the scissors, at which time the cut the sair in order to retrieve the from the pool. Once out of the pool, the immediately started CPR on the pool.

time, he had just finished dinner and went to play cards with the exact time, he had just finished dinner and went to play cards with the and other family members who were at his house located at the Approximately ten minutes after he started to play cards, he was unsure of the time, he believes it was around 7:30 PM, the started to play cards asked the life if he would turn on the jacuzzi for her so she could take a jacuzzi. The said yes to said yes to and walked out to the backyard, removed the jacuzzi cover from the jacuzzi and turned on the jacuzzi heater, filter, lights and jacuzzi bubble jets. He then went back inside and asked the lights and jacuzzi bubble jets. He then jacuzzi. It told told yes, she'll be fine in the jacuzzi.

Approximately 20 minutes after the later turned on the jacuzzi for the restroom. When she came from the restroom, she said Krista is not in the jacuzzi. told me that the card table about where the could be.

while then walked out to the front yard and checked the front yard for while the backyard and jacuzzi for white the inside of the house, then checked the backyard and jacuzzi for white the pacuzzi told me that he and his wife, and the walked in the backyard to the jacuzzi was on and looked into the jacuzzi and noticed that the light of the jacuzzi was on and the jacuzzi bubble jets were on. The light of the jacuzzi bubble jets and looked back into the jacuzzi and still did not see the inside the

			<u> </u>
Officer A. GREENBURG	PIN 1061	Supervisor	11/18
Page 4		Date	2/26/96
TYPED BY: P. BROWN /420805 HBPD FORM OFFENSE (rev. 12/91)		printed on	96-004443 02/26/96 at 12:

DR Number 96-004443

#### MAY-09-1996 09:25 FROM CPSC/FOWR

Date of Report: 02/25/96

#### HUNTINGTON BEACH POLICE DEPARTMENT CASUALTY REPORT

jacuzzi.		then went back	into the house.			
As walked back to the yard and decided to double che he was sure that the was not then walked over to the looked outsided and the jacuzzi. He drain at the east end of the him a pair of scissors, at whe scissors and brought them to cut the hair, enabling he	e the backyard are noticed that the jacuzzi. It is time im to remove the property of the prope	hen yelled for a ran inside, ret	try to pull stuck in the comeone to bring rieved a pair of the scissors to tuzzi.			
jacuzzi, he laid her on the deck, next to the pool, and immediately started CPR, at which time his neighbor, a nurse from across the street by the name of the street by the name of further details regarding the interview of management, refer to Officer MARTIN's supplemental report.						
Officer MARTIN, Officer COTTR Beach Medical Center to conduct details, refer to their supple	ct a follow-up in					
No further investigation was	conducted by me	at this time.				
	•					
			ì			
Officer A. GREENBURG	PIN 1061	Supervisor _	mo			
Page 5		Date	12/36/96			
TYPED BY: P. BROWN /420809 HBPD FORM OFFENSE (rev. 12/91)		printed o	96-004443 n 02/26/96 at 12:1			

#### ClearingHouse Format **Death Certificate File**

Not All States Reporting during Entire Period **U.S. Consumer Product Safety Commission** National Injury Information Clearing House

12/16/96 Page 1

Lot Number: 96044

Task Number:

Document Number: 9530004519

External Cause: 9138

Age: 6 Prod1: 837

WIRE, NOT SPECIFIED

Date Of Death: 08/18/95

Prod 2: 0

Date of Accident: 08/18/95

Sex: MALE

Date Entered: 08/09/96

Race: WHITE

State: MT

Workrel: N

Location: HOME

NO SECOND PRODUCT INVOLVEMENT

City: LEWISTOWN

Zip: 59457

Narrative:

PLAYING IN A TREE FELL WITH CORD AROUND HIS NECK - STRANGULATION;

**ACCIDENT - AUTOPSY NO** 

Lot Number: 96044

Task Number : /960821CAA5543

Document Number :

9530004555

Age: 10

WHIRLPOOLS, HOT TUBS OR HOME SPAS

External Cause: 9104 Date Of Death: 08/18/95

Prod1: 698 Prod 2: 0

NO SECOND PRODUCT INVOLVEMENT

Sex: FEMALE

Date of Accident: 08/18/95

Race: WHITE

Date Entered: 08/09/96 State: MT

Workrel: N

Location: SPORTS OR RECREATION PLACE

City: WHITEFISH

Zip: 59912

Narrative:

HAIR CAUGHT IN HOT TUB SUCTION DRAIN VENT - DROWNED - AUTOPSY YES

		FIEI	D ACTI	VITY COV	ERSHEET	<del></del>	
	1 Region/State 2 Operation (Check one)  Inspection Establishment visit 961024  Telephone contact X Investigation  Other 960821CAA5543						A55 <b>43</b>
5 B	stablishment Hydro Air Ind 1317 W. Grove Orange, CA 92	a Ave.			Telephone	<b>a</b>	
6 R	elated firm	Parent F	Headqua.	rters	Subsidia	ryOther	
7 P	roducts covered	•		8 Other	consumer p	roducts	
9 Establishment Type _X Manufacturer Importer _ Wholesaler Own label distributor _ Retailer Repackager _ Other			10 Annual production Product covered \$ units Other products \$ units				
	IS business % received % shipped	12 Samples col. None	lected	13 MIS 326		14 Hours Activity Travel	8 hrs hrs
	Reason for activity  Announced (Re	ty ationale for annot	unced i	nspectio	n)		
	Employee's Name James P. DiGraz.	ia	Title		Signature	date	
IDI conducted in response to a death certificate associated with a hot tub.  A ten year old female drowned in a hot tub when her hair became entangled in a suction cover. We were unable to establish when the hot tub was built but did obtain full identification of the suction cover. It does not appear to one that was designed to prevent hair entrapment. Suggest contined efforts to replace these older covers with ones that meet the ASME standard for antihair entrapment.							
19	Réviewer's Name James P. DiGrazia	Title Supervisory	Investi		Signature		
20	Review Date 961024	21 Distribut. O: EHDS		CCA [Hay	es]; SFRO	cc c/s: LD	B/LGC

#### Flathead County Sheriff Office Coroner Report

Case No: 95-9764 Coroner: Brock Wilson

Dispatch Time: 13:40 - Arrival Time: 13:54 Report Date: 08/18/95

Last Name:

First

Middle

95240017

DOB: 12/05/1984

Sex: F

Race: W Age: 10

SSN:

Address

City: COL FALLS

State: MT

Phone:

Zip Code:

Occupation: STUDENT

Employer:

Date of Death: 08/18/95

Pronounced Date: 08/18/95

Estimated Time of Death: 11:56

Pronounced Time: 13:27

Location of Death: NORTH VALLEY HOSPITAL

Funeral Home: JOHNSONS

Family:

OF

Rotation: X

Person Discovering Body:

Address: 🛎

59937-

Time: 11:55

2.

Phone: 4

Medication	Prescr. #	Physician	Pharmacy	Phone	Issued
					/ /
<u>.</u>					/ /
·					11

Personal Effects:

Cash: \$

0.00

Secured By:

Secured at Home? N Left at Funeral Home? F

Secured at S.O.? N

Released? N

To Whom:

Address:

Released By: Sudwell



## Flathead County Sheriff Office Coroner Report

	Report Date: 08/18/95
Cause of Death:  1. PENDING AUTOPSY  2.  3.  4.	Manner of Death:  Natural: Homicide:  Suicide: Accident: X  Pending Investigation:
Autopsy? Y Notified: 08/18/95 Coroner Present? N Locat Inquest? N	Pathologist: DR KELLENBERGER Time: 18:00 ion of Autopsy: JOHNSON MORTUARY
Investigator: MERICAL 7-16 Notified: 13:55 hrs. Arri	Department: FCSD val: 14:35 hrs. Report? Y Photos? Y
Identified By: MOTHER Name: Address: , —	Phone:
Next of Kin: MOTHER Name: Address:	COLUMBIA FALLS, MT –
Notified By: ON SCENE Notified Date: / / T	ime: :
Copied By: E/MUCR:	Filed By:
Dissemination (Y/N): CATTY: Y St. Med Exam: Y Signed By: Selech 7-	
Signed By: Duller 1-	Coroner



#### Flathead County Sheriff Office Coroner Report

Case No: 95-9764 Report Date: 08/18/95

Deceased 10 yr old and been and her friend who is 7 yrs old had gone to the pool and hot tub area at Anapurna Properties on the Big Mt., north of Whitefish. It was mother works at Anapurna and she and Mrs. were in the other building. and were in the hot tub when the adecided to go completely under water. She apparently did this a couple times and then did not surface.

pulled on pround once, thinking she was playing around, telling her to "quit goofing around and come up". The was observed in the hot tub by under water. He observed the and attempted to pull her out, but was unable to do so. He ran to shut off the pump and was joined by the from Flathead Mech., who went into the tub and attempted to pull up. Realizing her hair had been sucked into the pump suction vent, he pulled her hair loose, breaking the plastic vent grate, which remained in her hair.

CPR was started, and Whitefish ambulance responded along with ALS from North Valley Hospital. was transported to North Valley Hospital, and was attended to by Dr. Vaught in the ER. Efforts to revive her were unsuccessful and she was pronounced at 1327hrs.

Death appears to be caused from drowning, due to the victim's long hair becoming drawn in to the suction pipe in the hot tub. However there is no sign victim attempted to struggle to get free.

There was no loose hair in the filters or skimmers when checked by Det. Merical. There were also no indications from victim's fingernails that she had clawed at the tub or vent grate in a attempt to get free.

and went down past her shoulders. The flow rate in the hot tub vent was 60 gallons per minute. Temperature in the hot tub was approximately 101 degrees F. The tub had been drained prior to Det. Merical arriving on the scene.

No suspicious circumstances surrounding the death, with exception of lack of evidence to suggest victim attempted to get free. Per autopsy, cause of death is drowning, manner is accidental.

NOTE: Vent grate is in evidence at FCSO Lab.



## STATE OF MONTANA **DIVISION OF FORENSIC SCIENCE**

DEPARTMENT OF JUSTICE

Broadway Building—Sixth Floor 554 West Broadway Missoula, Montana 59802 (406) 728-4970

# CORONER'S

	Case #95-9764
REPORT FORM	Autopsy#
	MDFS #
SUBMITTING AGENCY: FLATHEAD COUNTY SHERIFF/C	
	proner/Deputy: Brack Wilson
DECEDENT: (Full Given Name)	
· Address: COL FALL	
	Race: X White Hispanic Native American
DATE & TIME LAST SEEN ALIVE []; OR IF KNOWN DATE &	
DATE & TIME FOUND IF TIME OF DEATH UNKNOWN:	
PLACE OF DEATH: NORTH VOLLEY HOSPITAL	
F DEATH IN HOSPITAL, DATE & TIME ADMITTED:	
AUTOPSY: X N N If YES, by Dr. DR KELLENBE	
OXICOLOGY SPECIMENS TAKEN?	
FINGERPRINTS TAKEN? 🗆 Y 🔎 N PHOTOG	
DEATH CERTIFICATE (D.C.) CERTIFIED BY 🔎 Coroner/De	
CAUSE OF DEATH (As appears on D.C.) <sub>PEND IND</sub> -AUTOPSY	
AANNER OF DEATH: ☐ Pending ☐ Accident ☐ I	Homicide 🗆 Suicide 🗆 Undetermined 🗖 Natural
MANNER OF DEATH:   Pending  Accident  I  DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, diations.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dial	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include
DETAILS SURROUNDING DEATH: (Describe below or cheast medical history; i.e. heart disease, hypertension, dialions.)	neck, if report attached. If applicable please include

Signature: \_

Coroner/Deputy

Exh + 2 964821CAA554



#### KALISPELL REGIONAL HOSPITAL

"We care for your health."

Autopsy A-95-22

Deceased:

. .

Age:

Date/Time of Autopsy:

Place of Autopsy: Autopsy Requested By: 10 years August 19, 1995, 1000 hours

Johnson Funeral Home, Kalispell, Montana

Flathead County Coroner, Deputy Brock Wilson

FINAL DIAGNOSES:

RESPIRATORY SYSTEM:

Lungs - Aspiration of Foreign Material - Probable Agonal

INTEGUMENTARY SYSTEM:

Hair - Head - Entangled Foreign Body - Drain Guard

Scalp - Subgaleal Hemorrhage - Recent

BODY AS A WHOLE:

Drowning - Accidental

Pathologist

10/06/95

135

GENERAL: The body is that of a well developed, well nourished, Caucasian female who appears to be near the stated age of 10. There are numerous signs of attempts at cardiac resuscitation. There is a gastric tube in place and a nasal tracheal tube as well as an indwelling catheter in the bladder. There are electrode plates on the right and left upper anterior thorax. There is an indwelling catheter in the right anticubital fossa. There are recent needle marks in both inguinal areas. There is a recent and sutured incision on the left lateral chest following the course between the seventh and eighth ribs. This incision measures 16 cm in length.

The patient has a luxuriant amount of hair and entangled within this hair is a plastic object. When removed, this is seen to be circular in shape, broken into two parts and measures approximately 14.5 cm in diameter. This object has numerous holes and is consistent with a drain quard.

The pupils are round, regular and equal. The lips are edematous and the tongue is clenched between the teeth. There is some fresh blood exuding from the nostrils.

The body is unembalmed and otherwise normal.


PRIMARY INCISION: The usual Y-shaped incision is made. Underlying the previously noted thoracic incision, there is mechanical separation of the seventh and eighth ribs. Underlying this area is noted a 6 cm linear defect in the anterior portion of the left leaf of the diaphragm with exposure of the stomach. The abdominal cavity, pericardial cavity and the pleural spaces are otherwise normal.

CARDIOVASCULAR SYSTEM: The heart weighs 270 grams. There are petechial hemorrhages on the surface of the posterolateral portion of the left ventricle. The heart is otherwise normal as are the aorta, great veins and the pulmonary arteries.

RESPIRATORY SYSTEM: The tip of the nasal tube lies in the upper portion of the mainstem bronchus. The arytenoid soft tissue is somewhat edematous and the surrounding mucosa is somewhat hemorrhagic. The mainstem bronchi and its branches are normal. The lungs are fully expanded. There are petechial hemorrhages on the pleural surfaces. On cut section, there is marked acute congestion but the lungs are otherwise normal.

GASTROINTESINAL TRACT: The bulb of the gastrointestinal tube is distended and lies in the mid-esophagus. The surrounding mucosa is somewhat hemorrhagic. The stomach, small and large bowel as well as the appendix are normal.

LIVER, BILIARY SYSTEM AND PANCREAS: The liver externally and on cut section is normal. The gallblader and extrahepatic biliary system are normal. The pancreas is normal.

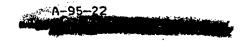



HEMATOPOIETIC SYSTEM: The spleen externally and on cut section is normal. The lymph nodes of the mediastinum and mesentery appear normal.

ENDOCRINE SYSTEM: The thymus weighs 76 grams. This shows numerous petechial hemorrhages and there are focal areas of interstitial hemorrhage. The thyroid externally and on cut section is normal. The adrenals are present bilaterally. Externally and on cut section, these are normal. The pituitary is grossly normal.

GENITOURINARY SYSTEM: The kidneys are present bilaterally. Externally and on cut section, these are normal. The ureters are normal. The bladder contains the tip of the catheter and is otherwise normal. The internal female organs are normal for an individual of this age.

HEAD: The scalp is of normal thickness and strips from the calvarium with ease. There is noted subgalial hemorrhage of recent origin, most marked at the vertex. The calvarium is otherwise normal, without evidence of fractures. Upon removal of the calvarium, the underlying meninges appear normal.

CENTRAL NERVOUS SYTEM: The brain externally and on cut section appears normal.


#### MICROSCOPIC:

Sections of lung show acute congestion, edema and foreign material in the alveoli. Vegetable fibers are noted.

Some sections (e.g. heart and thymus) show interstitial hemorrhage of recent origin without a cellular reaction or degeneration of the red blood cells.

All other sections are normal without evidence of pre-existing organic disease. These include trachea, heart, esophagus, pyloris, appendix, liver, pancreas, spleen, thymus, thyroid, adrenal, pituitary, skeletal muscle, kidney, ovary, uterus, cerebrum, basal ganglion, hippocampus, cerebellum, medula, spinal cord and pineal.

SUMMARY: This case appears to be one of accidental drowning. No pre-existing disease is found.

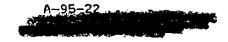

MI.

JOD 8/20/96

COLDENT INVESTIGATION REQUEST FORM CAPO X

Document Number 9	5 = 004 555	
Date of Incident 8	18/95 Category I.D. S	SECTUH
Follow-Up Requested	Hazard Analysis	Section 15
Type Follow-Up Requested	Telephone Call	On-Site
Headquarters Contact	Judith Hayes	
Assignment Message	Perform IDI 4	nicident
morning hair	entrapment. Co	btuin any
afficial men	lical and/or pass	ice reports.
Cobsum photos	s of drain core	r ne incident
abtain photos		
made of origin	al cover. Obtain	sire of spa
primp, Bush	tox length of have	# of nection
at time of me	Cident.	
<u> </u>		
Person(s) to Contact	Death cust. Office	ials Only
Guideline		
Requested By		
Task Number 96082	ICAA5543	
Assigned toSFOC	)Date 8/2	1/96
		12



# James R. Dupont Sheriff-Coroner

Flathead County 406-758-5585 FAX 406-758-5862

September 17, 1996

U.S. Consumer Product Safety Commission Western Regional Office 600 Harrison St., Room 245 San Francisco, CA 94107-1370

RE: Jessica E. Eisentraut Coroner Report - 95-9764

Enclosed is the coroner and autospy report of the above subject per your request of September 3, 1996. Included in the report are photographs of the hot tub and the drain. Please advise our Office if you wish copies of these photographs for your records.

There is a \$20 fee for the coroner report copy and an additional fee to have the photographs processed for copies.

Sincerely,

James R. Dupont

Sheriff



# James R. Dupont Sheriff-Coroner

Flathead County 406-758-5585 FAX 406-758-5862

September 30, 1996

U. S. Consumer Product Safety Commission Western Regional Office 600 Harrison St., Room 245 San Francisco, CA 94107-1370

RE: Jessica Eisentraut Coroner Report - 95-9764

Enclosed please find the requested photographs regarding the coroner report of the above subject. We are in receipt of your Check #2990 for \$30. Thank you.

The victim's hair was two feet to two and one half feet in length from the crown. The weight of the hair is unknown. There were no markings on the drain as the photographs will show.

Do not hesitate to contact our Office if you have further questions.

Sincerely,

James R. Dupont

Sheriff

Enc.

El. 3

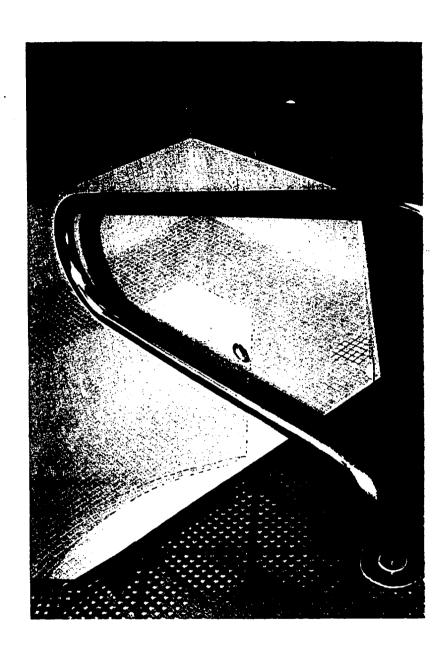


Photo #1: View of hot tub from ground level showing configuration, depth, ledge, drain and hand rail.

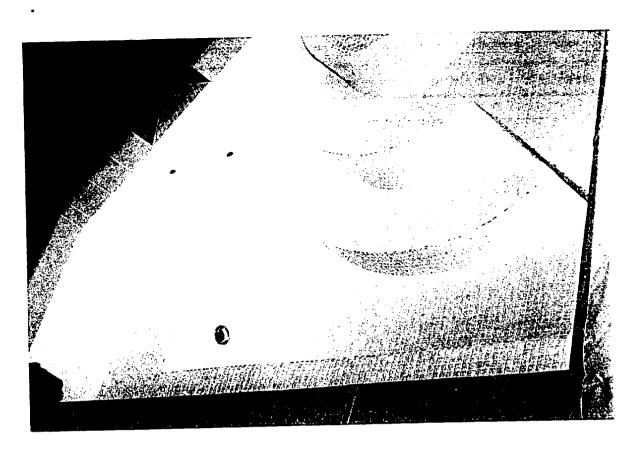


Photo #2: View of hot tub from ground level showing steps and inlets.

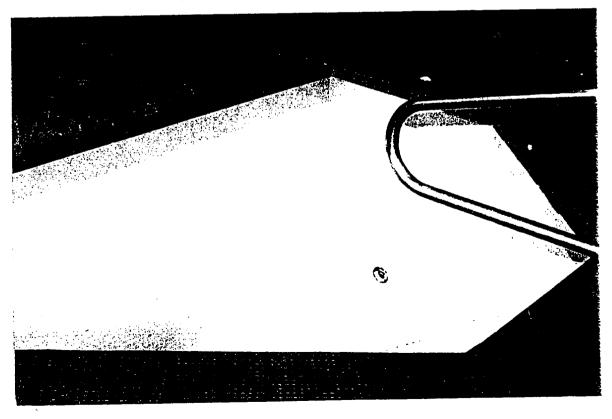


Photo #3: Another view of hot tub.

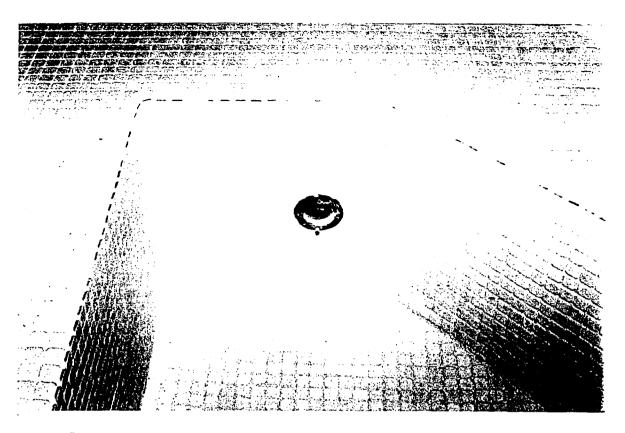


Photo #4: Closer view of floor area, seating ledge and drain.

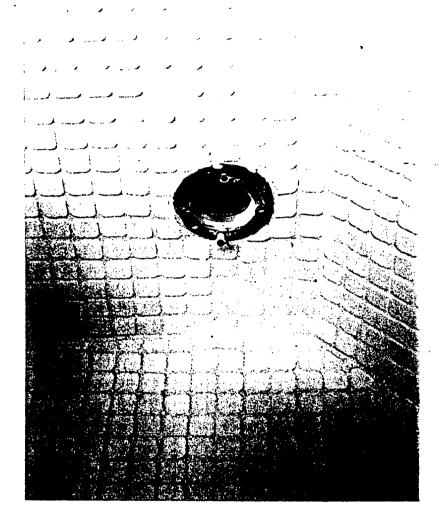


Photo #5: Close up of drain showing remains of suction cover.

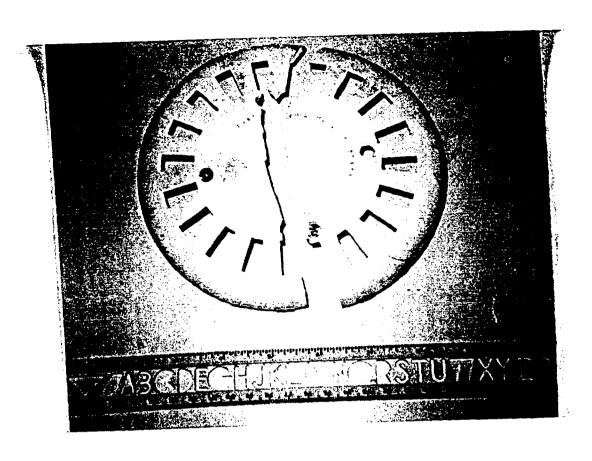


Photo #6: Close up of suction cover.



Photo #7: Victim's hair entangled in suction  $\hat{c}$ over.



Photo #8: Victim's hair entangled in suction cover.



Photo #9: Same as above.

1417

I

1. CASE NO. 960228CWE6001		2. INVESTIGATOR'S ID [9][0][3][5]		3. OFFICE CODE [8 ][6 ][0 ]		EPIDEMIOLOGIC			
	MO DAY						INVE	STIGATION	
4. DATE OF INCIDENTR		NVESTIGATION ED		YR MO DAY [9][6][0][3][1][9]		REPORT			
							·		
6. SYNOPSIS OF INCIDENT OR COMPLAINTA 12 year old female died from fresh water drowning in the families backyard spa after her shoulder length hair became entrapped in the suctiondrain cover of the spa.									
her shoulder length that became entrapped in the suctionarian cover of the spa.									
•									
								•	
7. LOCATION (Home, so	8. CITY				9. STATE				
Backyard	Huntington Beach				CA				
10A. FIRST PRODUCT 11A. TRADE/BRAND NA					E, MODEL NUI	MBER, MA	ANUFACT	URER & ADDRESS	
Home Spa [0][6][9][8			[8] Possible Manufacturer is Beachport Spa, No additional information could be obtained						
10B. SECOND PRODUCT Suction Cover [ ][ ][ ][ ]			11B. TRADE/BRAND NAME, MODEL NUMBER, MANUFACTURER & ADDRESS						
Suction Cover	Hydro Air, Address unkn			nown.					
12. AGE OF VICTIM	13. SEX (USE MALE - 1	NUMERICA	L CODE) 14. DISPOSITION Died				15. INJURY DIAGNOSIS Drowning		
[0][1][2]	FEMALE - 2	[2]	[8]				[6 ][9 ]		
UNKNOWN- 3									
16. BODY PART [8][5]		RESPONDE	NT(S) (Mother, Friend)		18. TYPE INV	ESTIGAT	ION	19. TIME SPENT	
[ [ [ [ ]	ici oc Giai	[2]		TELEPHONE - 2		[1]	[2][3].[5]		
					OTHER - 3			to the interior	
20. ATTACHMENTS		21. CASE	COURCE		22 DEVIEWS	DDV		D MO DAY	
Multiple			[0][5]					R MO DAY [ 9][6][0][4][1][8	
					l l l l l l l l l l l l l l l l l l l				
23. PERMISSION TO DISCLOSE NAMES  (NON-NEISS CASES ONLY) CPSC MAY DISCLOSE MY NAME [ ] CPSC MAY NOT DISCLOSE MY NAME [XX]									
24. NARRATIVE (See Instructions on Page 2)					25. REGIONAL OFFICE DIRECTOR REVIEW DATE				

161

IDI: 960228CWE6001 Keven Barton (9035) March 19, 1996 Page #2

The information contained within this report was provided by the victim's father and grandfather. Additional information was obtained from official reports.

#### Pre-Event:

The victim was described by her father as a healthy and active 12 year old female, who weighed 91 pounds and was 61" tall. According to the victim's father his daughter loved the water and was a very good swimmer. The victim had lived in Hawaii for eight years, during which time she snorkeled and swam in the ocean. She also swam in swimming pools, and had been in various spas and hot tubs. The victim and her father had been residing in another state and were vacationing at the home of the victim's grandparents in California.

The victim had straight blond hair which was just past her shoulders. The father said that her hair was fine but she had lots of it.

According to the victim's grandfather when he purchased his residence two years ago there was a fiberglass spa in the backyard. The spa was similar in looks and design to a portable unit except that it was recessed into the ground and surrounded by a wooden deck, photographs #1-8, exhibit #8. The mechanical units (filter, pumps, heater) were located approximately 23 feet from the unit. An "L" shaped wooden fence partially obstructed the view of these components, photograph #2, exhibit #8. The spa was seldom used by the victim's grandparents, and did not require any professional servicing or repairs. The grandfather regularly cleaned the spa and tested the water for proper chemical levels. The filter, and the leaf catchers in the pump and blower units were cleaned as needed. The built-in light required resealing which was done by the victim's grandfather. No other servicing was required or conducted.

During her two week stay at her grandparents home, the victim was always asking if she could swim in the spa. She was allowed to do so on one occasion for approximately 10 to 15 minutes. However, the victim continued asking if she could go into the spa again. Sunday, February 25, 1996, was the last day of the victim's vacation. Her grandfather cleaned the spa in case her father allowed her to use it. At approximately 7:00 p.m. the family finished their evening meal. They retired to the garage to play cards with other family members who were present. At approximately 7:30 p.m. the victim's father allowed her to use the spa. The victim's grandfather went to the backyard with her and turned on the spa and the underwater light.

IDI: 960228CWE6001 Keven Barton (9035)

March 19, 1996

At approximately 7:50 p.m. the victim's grandmother went to the bathroom. There is a window in the bathroom which overlooks the spa. The grandmother looked out the window and did not see nor hear the victim. She advised her husband, and they searched the house and backyard. The spa was still operating but there was no sign of the victim. The grandfather turned off the spa and its light and returned to the garage. They advised the victim's father that the victim was not in the spa and could not be found. The victim's father looked in the yard and checked with several neighbors to the West. Approximately 8:00 p.m. the victim's father looked into the spa again. He was concerned because the victim's sweat pants and towel were still on the wooden deck next to the spa.

#### **Event**:

When the grandfather turned on the spa light they saw the victim face up with her head apparently attached to the spa drain.

#### Post-Event:

The suction drain is located on the side of the spa near the bottom. Both the father and the grandfather jumped into the spa, but were unable to remove the victim. A pair of scissors were obtained, and after about three to four attempts the father was able to free the victim.

The victim's grandmother had already phoned 911 emergency and the family began CPR until the paramedics arrived. The victim was transported to a local hospital and was pronounced dead at 2043 hours on February 25, 1996. Cause of death was listed in the coroner's summary as fresh water drowning. Blood alcohol level was 0.00%.

According to the father, the grandparents may not have originally seen the victim in the spa because of the bubbles created by the jets. Also the victim was wearing a brown colored swim suit which was similar in color to the spa.

#### Product Identification:

Efforts to identify the manufacturer of the spa were unsuccessful. There were no identifying labels or marks which could be traced to a specific manufacturer. A logo was cast into the fiberglass on the bottom of the spa. This was copied and shown to several spa retailers, but the identity of the spa manufacturer could not be identified. A copy of the logo design is appended as exhibit number one.

IDI: 960228CWE6001 Keven Barton (9035) March 19, 1996

A copy of the city building permit was obtained from the city building department. The owner builder permit appears to be dated November 29, 1982, and is for a Beachport Spa. A review of the 1996 North Orange county yellow pages, the 1992 Business to Business phone directory, covering Orange, Inland Empire and San Diego County, and the 1996 greater Los Angeles yellow pages failed to reveal a listing for Beachport Spas.

It is unknown if any of the components were professionally installed, since the permit indicates an owner builder.

A private investigator working for the families attorney claimed that Beachport Spas was once located in San Clemente, CA. However, a check with directory assistance failed to reveal a listing. The investigator advised that he has been unsuccessful in locating a company named Beachport Spas.

The spa is approximately 85" outside and 73" inside diameter, 36" deep, has eight sides and seven jets and molded seats. The jets appear to be adjustable. There is a light mounted on one of the sides near the bottom. The suction cover was removed by the police and fire department and held as evidence. The suction cover was mounted on the side of the spa near the bottom of two steps that lead into the spa.

The controls for the filter, blower, jets, light, and heater are mounted on the outside wall of the house approximately 7'-6" to 8' from the spa and about 4' from the top of the deck, photographs #5-6, exhibit #8. According to the victim's uncle the spa light, heater and jets were turned on at the time of the incident. The pump and filter are 220v and the blower is 120 volt.

The suction cover was in the possession of a private investigator working for the families attorney. I met with him and examined and photographed the cover. The cover was manufactured by Hydro Air, and had the code sequence of p/n 10-6200 and the initials U.S.P.C. The cover was about 6" in diameter and the threaded portion for connecting to the spa was about 2-7/8" in diameter. No other identifying marks could be located. There were no obvious signs of the cover or other components being tampered with, photographs #15-18, exhibit #8.

It is unknown if the pump, blower, filter or heater had ever been replaced. The grandfather had never replaced any of the units in the two years he has owned the home.

IDI: 960228CWE6001 Keven Barton (9035) March 19, 1996

### Product Identification:

Filter Pump:



Motor for Filter Pump:



Heater:



Filter:



IDI: 960228CWE6001 Keven Barton (9035) March 19, 1996

#### Product Labeling:

The spa contained two labels located on the upper portion of the spas side just above the first step. The labels read:

Photograph #15, exhibit #8.

WARNING DO NOT EXCEED 104

2. Photograph #14, exhibit #8.

#### CAUTION

The Consumer Product Safety Commission has stated that water temperature in a spa or hot tub should not exceed 104F immersion in water in excess of 104F could be hazardous to your health, children, aged persons, persons having medical problems and pregnant women should consult their physicians before using a spa or hot tub. Spa or hot tubs should not be used by persons under the influence of alcohol or by persons taking medication which induce drowsiness.


No other identifiable markings could be located on the unit.

#### Exhibits:

- 1. Drawing of spa logo.
- 2. Copy of building permit.
- Police report.
- 4. Fire and Paramedic report.
- 5. Coroner summery report.
- 6. Catalog for Hydro Air pump.
- 7. Copy of Los Angeles Times article provided by grandfather.
- 8. Photographs and Negatives.
  Authorization for release of name.
  Assignment.

EXHITE 1 41 LIB 3/21/96 960-TCBCUEGOCY

APR 29 1995

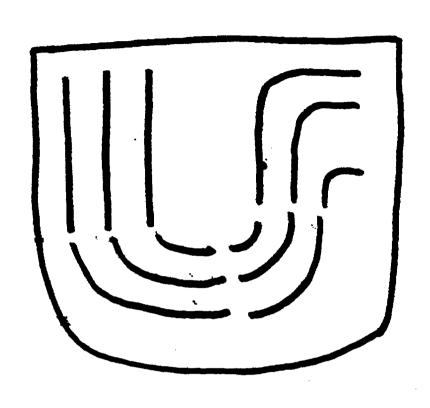

EXHITET # Z KB 4/3/96 9607680001

SP 8776

## **SWIMMING POOL PERMIT**

CITY OF HUNTINGTON BEACH DEPARTMENT OF DEVELOPMENT SERVICES P.O. BOX 190 - CALIFORNIA 92648 FEES (714) 536-5241 **Building Permit** Building Plan Check 3 ï P.C. Addiess \_ Lot No. Conservation Block Tract No. - 110 Plumbing 966 Owne Electrical Addre Fres item No. **Bach** - 50 Tel. No **Fixtures** Contractor CUNER Switches .50 Outlets Address Mators HP = 0 to 1 27 2.40 City Tel. No. 5.00 Over 1 to 5 5 City Lic. No. State Lic. No. 2 2.40 Time Clock Yes . Costal Permit Zune Altering Service 12.50 5.00 Sub Panel Remarks: 10.00 Issuance Fee TOTAL FEES .... Area of Poul SFA I have read this application and agree to comply with all local and state laws applicable to building construction.

It is an validity registered and licensed as required by the City of Huntington Beach and the biste of California, or in the legal owner of the above described property.

I have filled with the City of Huntington Beach of Industrial Relations, or industrial Relations, or industrial Relations, or in admitted insurer, or in admitted insurer, or in a certificate of workers' compensation indurance issued by an admitted insurer, or in a certified by the Director or the insurer, or in a certified by the Director or the insurer, or in the performance of the work for which this permit is issued, I shall not enable any person in any manner so as to become subject to the workers compensation laws of the State of California.

I certify (or declare) under cenalty or certified on the discussion of the configuration was executed on the 2.9. day of the configuration was executed on the 2.9. day of the configuration was executed on the 2.9. day of the configuration was executed on the 2.9. day of the configuration was executed on the 2.9. day Valuation APPROVALS nspector ٠,٠ , 1 10/105 Bonan Liectur Rough Plumbins If work is not commenced 180 days from date of issue of this permit, or if work is abandoned for more than 180 days, this permit . as Test P Trap . shall be null and void. JI-27-2 Elect. Final Land Use App Fencing - Gate Permit Authorized Date //- 29 .) O.K. to Plaster Permit Issued By Pool Final, J-Boxes, Cover Receipt No.

THE FLICK

168